

OREGON CORNER RESTORATION FORM

Section 2 Township 1S Range 31E
 County Umatilla Date: October 3, 2001

Corner Designation: 1S31A19


Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out

North 1/4 section corner to section 2, T1S, R31E,
 W.M., Umatilla County, Oregon.

Previous Renewals / Surveys, etc.

The corner was originally set by David P. Thompson under contract No. 106 dated August 16, 1864. His record reads: Set post for 1/4 sec. corner in mound of earth with charred stake, pits, trench and C. as per instructions.

Monument and Accessories found: (condition and source)
 None.

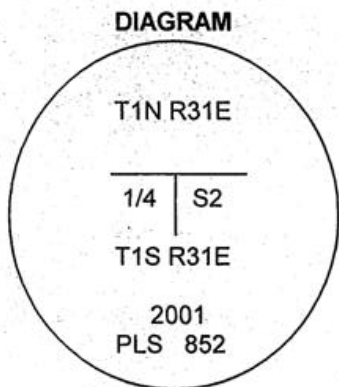

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

At the proportionate point I set a 30" x 1 1/2" G.I.P. with a 2 1/2" brass cap stamped as shown in the diagram above 20" in the ground. I raised a 3' mound of stone around the cap and set a 5' steel guard post with a County monument sign attached along side.

For references, I set four 5/8" by 24" rebars with 1 1/4" red plastic caps stamped ORLS 852, and WALS 13922 as described below:

- an iron rebar bears S24°36'10"W, 66.64 feet, at the existing fence corner;
- an iron rebar bears S19°04'26"W, 101.68 feet, under the existing fence;
- an iron rebar bears S6°43'16"E, 58.92 feet, under the existing fence;
- an iron rebar bears S33°42'52"E, 68.95 feet, under the existing fence;

The monument and references were tied using a LIECA SYSTEM 300 RTK GPS.

Location and comments
 OR SPC Oregon North 1983-91
 N = 678067.33
 E = 8610972.64

Compass Declination

Surveyors Seal

RECEIVED BY:
Umatilla County Surveyor
 Date: 12/20/2001
 Rec'd By: DH
 No. 01-206-C

Firm / Agency
 Haddock Surveying
 Address
 P.O. Box 1574
 Pendleton, Or. 97801
 Party Chief
 Stephen K, Haddock

**REGISTERED
 PROFESSIONAL
 LAND SURVEYOR**

David L. Haddock

**OREGON
 JULY 12, 1999
 DAVID L. HADDOCK
 852**

RENEWS 6-30-03