

# OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 04/17/17.

CORNER DESIGNATION: N-5, The Southeast corner of Section 18, Township 2 North, Range 28 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC: Corner originally established by David P. Thompson Contract No. 83 dated July 22, 1859. Notes state: Set post corner for corner to Secs. 17, 18, 19 & 20 in mound of earth & as per instructions. The corner point was recovered by John Kimbrell, Deputy County Surveyor, in Survey No. 357, recorded at Record of Private Survey Book 2, Page 216, in December, 1912. Kimbrell reports setting a marked square wood post 18" in the ground at the corner point.

MONUMENT AND ACCESSORIES FOUND: Old fence intersection with fences extending East-West and North a short distance. Accepted the fence intersection as best remaining evidence of the original corner position.

### MONUMENT MARKING DETAIL:

T2N R28E  
S18 | S17  
-----  
S19 | S20  
2017  
PLS 1106

MONUMENT SET: At the fence intersection, set a 1 1/4 by 30" galv. iron pipe with 2 3/8" brass cap 28" in the ground. Placed a 6 by 8 by 9" granite stone just North of the corner monument. Cap is marked as shown in "Monument Marking Detail".

### New accessories:

A 5.8" by 24" rebar bears N 72°33' E, 19.8 feet. This is a control point for the survey, and does not have a red plastic cap or bearing object sign.

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears S 85° E, 32.2 feet.

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears West, 13.1 feet.

A 5/8" by 24" rebar with 1 1/4" red plastic cap bears N 87° W, 28.3 feet.

The red plastic caps are marked "ORPLS 1106 WAPLS 17372". All rebar accessories are set in the existing fence lines, (except the rebar control point, and have "bearing object" signs wired to them. Nailed a "witness" sign to a wood fence post 3 feet East of corner and to a wood fence post 5 feet North of corner.

LOCATION AND COMMENTS: Corner is located at the intersection of an East-West-North fences, near the Southerly end of a field road.

FIRM: Wells Surveying  
P.O. Box 1696  
Pendleton, OR 97801


COMPASS DECLINATION: 18° East

\2N28N5

Surveyor's Seal



*William R. Wells*

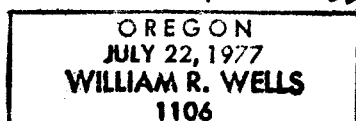

renews 6-30-18

17-065-C