

**OREGON CORNER RESTORATION FORM**

Section 30 Township 1N Range 32E  
 County Umatilla Date: July 25, 1997

Corner Designation: 1N32V5

Condition Report Only  
 Not found

Corner to sections 29, 30, 31, and 32 T1N, R32E, W.M..



Remonumented  
 Unrecorded  
 Surveyed in  
 Referenced out

Previous Renewals / Surveys, etc.

Corner originally set by Daniel Chaplin under contract No. 107 Dated September 21, 1864.  
 His record reads: Set stone 20 x 12 x 8 for corner to sections 29, 30, 31, and 32..

This point was identified as the corner by the road survey for County Road #1382 (Winget Rd.)

Monument and Accessories found: ( condition and source )  
 None.

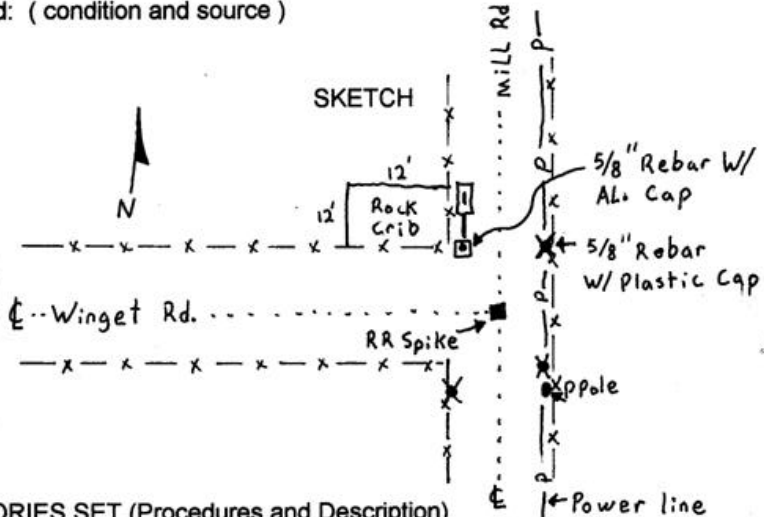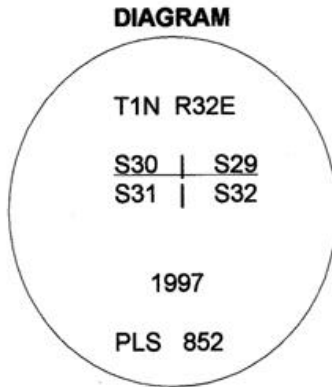

**MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)**

Set a Railroad spike at the centerline intersections of County Roads No. 1382 (Winget Road) and No. 1383 (Mill Road).

For references, I set three 5/8" by 24" rebars with 1.25" red plastic caps stamped ORLS 852 and WALS 13922 as described below:

- a rebar bears N42°02'E, 34.63 feet under the existing fence;
- a rebar bears S47°58'E, 25.24 feet at the foot of a power pole;
- a rebar bears S43°26'W, 41.05 feet under the existing fence;

Set a 5/8" x 24" rebar with a 2" Aluminum cap stamped ORLS 852, WALS 13922, T1N R32E S30 B.O. at the foot of the one mile paddle for Mill Road N48°33'W 34.42 feet.

The monument was established at the intersection and surveyed using GPS receivers.  
 References were tied using a Geodimeter system 600, 3 second Electronic Total Station.

Location and comments

Compass Declination

Surveyors Seal

RECEIVED BY:  
Umatilla County Surveyor  
 Date: 7/30/97  
 Rec'd By: David H. K. Haddock  
 No. 97-145-B

Firm / Agency  
 Haddock Surveying  
 Address  
 P.O. Box 1574  
 Pendleton, Or. 97801  
 Party Chief  
 Stephen K, Haddock

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*David L. Haddock*

OREGON  
 JULY 12, 1988  
 DAVID L. HADDOCK  
 852