

OREGON CORNER RESTORATION FORM

Section 15,16,21,22 Township 3N
County Umatilla Date: 03/11/10

Range 29E

Corner Designation: 3N29N13

Corner common to Sections 15,16,21 and 22 T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by N.H. Gates in 1859. He set a post in a mound of earth with charcoal. Perry found a basalt rock in a survey in 1919, book 2 page 308. PLS 933 set a brass cap in place of rock in survey #Q-1655-B, and a Brass cap witness corner S89°13'01"W, 320.00'. PLS 852 referenced the found Brass cap, LCR #98-155-C


Monuments and Accessories Found: (Condition and Source)

A 2.5" B.C.
A 5/8" Iron rebar w/rpc #852 lies N 63° 50' E, 85.10', in top of concrete headgate.

Diagram

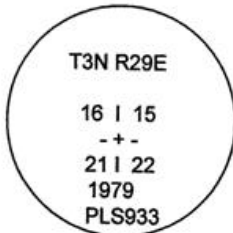

Sketch

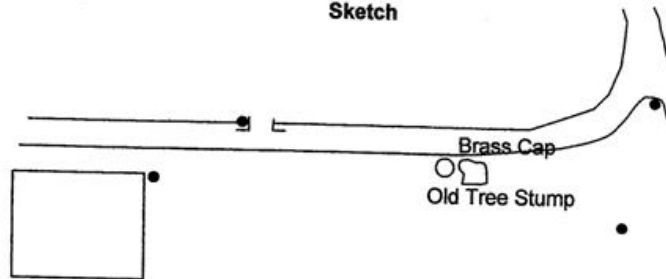

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N756285.51
E8538168.70

LAT - 45° 00.8197241" N
LON - 119° 11' 01.73272879" W

Monument (s) Set (Procedures and Description)

None.

References Set:

- A 5/8"x30" Iron rebar w/rpc #43406, near the corner of the garage, lies S 86°50' W, 85.64'.
- A 5/8"x30" Iron rebar w/rpc #43406, near a concrete headgate, lies N 74° W, 50.45'.
- A 5/8"x30" Iron rebar w/rpc #43406, lies S 64°30' E, 60.54'.

Location and Comments

The corner is located South of Echo 0.5 miles on Hwy. 30. Near a farm house, owned by Dick Snow.

Compass Declination
17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 3-10
Rec'd By: KK
No. 10-35-R

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/11