

OREGON CORNER RESTORATION FORM

Section 29,30,31,32 Township 3N
County Umatilla Date: 02/10/10

Range 29E

Corner Designation: 3N29V5

Corner common to Sections 29,30,31,32 T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


Previous Renewals / Surveys, etc.

Originally Surveyed by David P. Thompson. He set a post in a mound of earth in 1859. Harris set a stone and a 1/2" Iron rebar in survey #Q-1655

Monuments and Accessories Found: (Condition and Source)


A 1 1/2" Galvanized Iron pipe w/ rivet still intact, Brass cap is missing. No record. A stone was found near the found monument fitting the description in the Harris survey #Q-1655. I suspect this corner was monumented by the Bureau of Reclamation, as it matches other monuments found.

Diagram

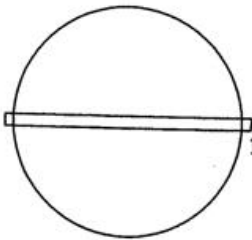

1 1/2" Pipe w/rivet

Sketch

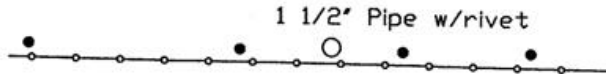

1 1/2" Pipe w/rivet

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N745369.87
E8527704.48

LAT - 45° 42' 14.71965677" N
LON - 119° 13' 31.67133463" W

Monument (s) Set (Procedures and Description)

None.

References Set:

- A PK nail w/ brass washer #43406LS on a RR Tie fence post lies West, 57.97'.
- A 5/8"x30" Iron rebar w/ypc #43406LS lies S 81°00' W, 8.55'.
- A PK nail w/ brass washer #43406LS on a RR Tie fence post lies S 69°00' E, 5.29'.
- A PK nail w/ brass washer #43406LS on a wooden fence post lies S 85°00' E, 22.25'.

Location and Comments

The corner is 1/2 mile West of a cattleguard on Snow Road, South app. 2.1 miles South of the intersection of Snow Road and Hwy. 320. There is a good farm road nearby to the corner.

Compass Declination
17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Firm / Agency

Date: 3-10
Rec'd By: KE
No. 10-43-R

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/11