


OREGON CORNER RESTORATION FORM

Section 27,26 Township 4N Range 37E W.M.
County Umatilla Date 8/1/93
CORNER DESIGNATION: T-17

Previous Renewals/Surveys, etc. The original survey was made by George S. Pershin, under contract No. 332, dated July 29th, 1879. He set a fir post on N. slope for 1/4 Sec. Cor. from which:
A tamarack, 8 ins. diam. brs. N.28°E., 90 lks. dist.
A tamsrack, 9 ins. diam. brs. S.63°W., 5 lks. dist.

Monument(s) & Accessories Found: (Condition and Source) Found a 5/8" rebar with a plastic cap stamped LS 645 from which two recently cut BT's:
A 15" tamarack stump marked /4S S26 X BT brs. S.69 1/2°E., 17.7 ft.
A 12" tamarack stump marked S S27 X BT brs. S.50°W., 22.2 ft.
I found no record of the rebar or the BT's. Map No. N-65 indicates that Hambleton found evidence of the original G.L.O. corner.

Monument Detail:

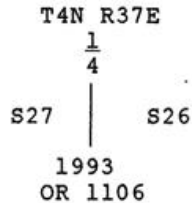

Monument Set (Procedures and Description): Set a 1 1/2" x 30" iron pipe with a 2 1/2" brass cap marked as indicated in the monument detail, 24" in the ground. There were no rocks available for a mound.

New Accessories:

A 8" fir brs. S.25°E., 50.6 ft. marked T4N R37E S26 BT
A 7" fir brs. S.88°W., 23.9 ft. marked T4N R37E S27 BT
A 8" fir brs. N.28°W., 70.8 ft. marked T4N R37E S27 BT
A 9" fir brs. N.52°E., 43.6 ft. marked T4N R37E S26 BT
A steel fence post with a Land Survey Monument sign attached and an old fence line bears N. 2.8 ft.

Location & Comments: The corner falls in a heavily logged area 60' E. of a fence intersection, fences run East, West, and South.

Compass Declination: 18° E

Surveyor's Seal

Firm/agency: Tomkins-Wells Joint Venture
Land Surveying
P.O. Box 1696
Pendleton, Oregon 97801

Party Chief: Greg Flowers
Notes: Greg Flowers
Witness: Todd Rosenbalm

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells
OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

expires 12-31-94

93-64-C