


History of original corner establishment:

Original survey was made by George S. Pershin under contract No. 332, dated July 29, 1879. The corner was set Aug. 18, 1879. He set a tamarack post on SW face of hill for 1/4 Sec. Cor. He set the following bearing trees: A tamarack 10" dia. bears N 34 W, 3/4 lks. dist. A tamarack 8" dia. bears S 50 E, 12 lks. dist.

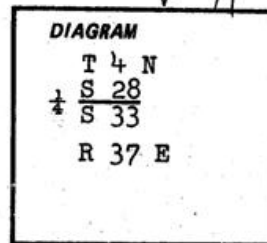

Description of corner evidence found:

I found a tamarack stump approx. 12" in dia. and being badly rotted though it had the lower portion of a blaze which was partially healed over and facing in a NW direction fitting GLO description of 8" tamarack bearing S 50 E, 12 lks, dist. No evidence of the second tree as its position was in an old skid trail. Using this evidence, I tied the location in to my coordinate system and found the position of the 1/4 cor. to be harmonious with the surrounding evidence and the found corners in the area; therefore accepted this evidence as being part of the original 1/4 corner accessories.

Description of monument and accessories I established to perpetuate the original location of this corner:

Using the GLO bearing and distance S 50 E, 12 lks. dist. for the bearing tree located in Section 33, I then set a 2" galv. iron pipe with a 2 1/2" brass cap at the location of the 1/4 corner common to Sections 28 & 33 from which I set the following new bearing trees: A fir 10" dia. bears N 14 W, 21.37 ft. scribed 1/4 S S 28 BT. A fir 9" dia. bears S 61 W, 26.83 ft. scribed 1/4 S S 33 BT.

Cap Stamped
T 4 N
1/4 S 28
1/4 S 33
R 37 E
1978



Office of..... County of.....
State of..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)