

**OREGON CORNER RESTORATION FORM**

Section 19 Township 1N Range 32E  
 County Umatilla Date: September 18, 2009

Corner Designation: 1N32P1


Condition Report Only  
 Not found  
 Remonumented  
 Unrecorded  
 Surveyed in  
 Referenced out

Quarter corner to section 24, R31E, and Section 19, R32E, T1N, W.M., Umatilla County, Oregon


Previous Renewals / Surveys, etc.

Corner originally set by Josiah A. Burnett under contract No. 92 Dated September 12, 1860. His record reads: Set a post for 1/4 sec. cor., drove charred stake and raised mound with trench as per instructions.

Monument and Accessories found: ( condition and source )  
 None.

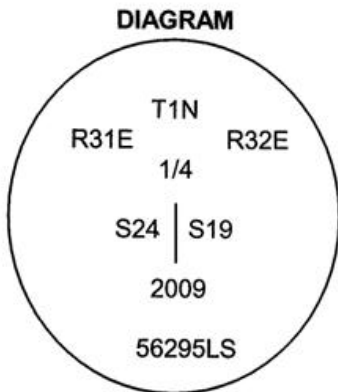

- ⊙ = Brass Cap
- = Rebar Reference
- = Steel Guard Post

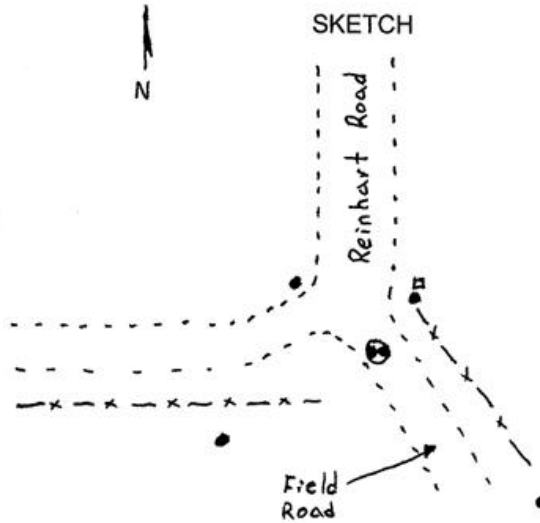

**MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)**

Set a 1 1/2" x 30" galvanized iron Pipe with a 2 1/2" brass cap stamped as shown in the diagram above at the proportioned point. The cap lies 6" below the surface of a farm field access road. I poured concrete around the cap.

For references, I set four 5/8" by 24" iron rebars with 1 1/4" Orange plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears S62°16'39"W, 163.18 feet;
- an iron rebar bears S34°16'11"E, 119.44 feet;
- an iron rebar bears N29°28'32"E, 13.34' feet;
- an iron rebar bears N42°22'52"W, 78.75 feet;

The monument was set and references tied using a Trimble R7/R8 RTK GPS system.

Location and comments  
 NAD 83/1991 State Plane Coordinate  
 Oregon North Zone  
 N=691,411.58 ift  
 E=8,619,261.86 ift

Compass Declination

Surveyors Seal

RECEIVED BY:  
Umatilla County Surveyor  
 Date: 6-10  
 Rec'd By: KK  
 No. 10-23-C

Firm / Agency  
 Witness Tree Surveying  
 Address  
 P.O. Box G  
 Pilot Rock, Or. 97868  
 Party Chief  
 Stephen K, Haddock

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Stephen K. Haddock*  
 OREGON  
 JULY 9, 2001  
 STEPHEN K. HADDOCK  
 56295LS

RENEWAL DATE 6-30-11