

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 05/12/08

CORNER DESIGNATION: 1N34, R-9, The Northwest Corner of Section 28.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner was originally established by Currin and Noland under Special Contract dated May 4th, 1887. Original notes state: Set a basalt stone 10x8x7, 7 ins in the ground, marked with 2 notches on South and 4 notches on East edges, from which: A pine 12 ins. diam. bears S 25° W, 350 lks marked S29 BT. A pine 10 ins. diam. bears S 4° E, 384 lks marked S28R34EBT. A pine 10 ins diam. bears N 30° E, 236 lks marked S21 T1N BT. A pine 10 ins diam. bears N 37° W 272 lks marked S20 BT.

John Kimbrell, in his survey No. 162, in April-May of 1903, "reestablished the corner in a plowed field, and set a stone for corner". Kimbrell does not state how the corner was reestablished, but he did not measure North from the reestablished corner, as would be required for a double proportion. I believe Kimbrell reestablished the corner from remains of the original bearing trees, as his survey was only 16 years after the original survey. Kimbrell also recovered the original 1/4 corner 1/2 mile West and established the 1/16th corner between. Said 1/16th corner now has fence or fence line remains extending East-West and North from it.

MONUMENT AND ACCESSORIES FOUND: None. Corner point falls near a East-West fence line which has existed in place since before 1964. Historically the entire area surrounding the corner was a hay field.

MONUMENT MARKING DETAIL:

T1N R34E

S20 | S21

S29 | S28

2008

PLS 1106

MONUMENT SET:

Re-established corner by holding the existing East-West fence line for latitude and proportionate distance from the fence corner perpetuating the East 1/16th corner between Sections 20 and 29, per Kimbrell Survey No. 162, in 1903. At the re-established corner point, set a 2 3/8" brass cap on 1 1/4" by 30" galvanized iron pipe, 27" in the ground. Cap marked as shown in monument marking detail.

New accessories:

A 5/8"x24" iron rebar with 1 1/4" red plastic cap marked "ORPLS 1106 WAPLS 17372" bears North 34 1/2° East, 27.8 feet.

A 5/8"x24" iron rebar with 1 1/4" red plastic cap marked "ORPLS 1106 WAPLS 17372" in fence line bears North 89 1/2° East, 41.3 feet.

A 3/4" dia. brass washer stamped "PLS 1106" in the North side of a 3" dia. Hawthorne, 1 foot above ground line bears South 13° East, 58.0 feet.

A 3/4" dia. brass washer stamped "PLS 1106" in the East side of a 5" dia. Hawthorne, 1 foot above ground line, bears North 90° West, 35.8 feet.

Attached bearing object signs to trees and iron rebars accessories. Attached "Witness" sign to steel fence post in East-West fence just South of the corner monument.

LOCATION AND COMMENTS: Corner is located in a East-West fence line.

OREGON STATE PLANE COORDINATE, North Zone, NAD

83(COORS96)(EPOCH:2002.000), International Feet:

N = 690399.52 Coordinates by OPUS solution position.

E = 8693988.31

FIRM: William R. Wells, PLS

P.O. Box 1696

Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

1N34R9

RECEIVED BY

Umatilla County Surveyor


Date 7-08

Rec'd by KK

No. 08-96-R



William R. Wells

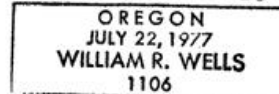

renews 6-30-08