
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Currin and Noland under GLO contract dated May 4th 1887. Field notes state: Set Basalt Stone 14 x 10 x 6 ins. 9 ins. In the ground for cor. To Secs. 15, 16, 21, and 22. Marked with 3 notches on S and E edges. Raised mound of stone over it.

T 1 N R 35 E N-13

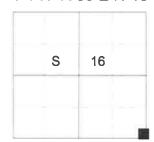

DESCRIPTION OF CORNER EVIDENCE FOUND:

No original corner evidence found. From a proportionate position:

A Douglas Fir with BCC tag falls approximately 30' North of corner marked "Approx 10.1 ft. $\rm E$ ".

A Douglas Fir with BIA tag falls approximately 60' South of corner, marked "Approx Sec".

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position, I set a 2 1/2" x 30" Aluminum Pipe, 25" in the ground with a 2 $\frac{1}{2}$ " Aluminum cap marked as shown below, from which:

NEW BEARING TREES:


A 17" Douglas Fir bears North 70° East, a distance of 10.50 feet, marked T1N R35E S15 BT. A 17" Douglas Fir bears South 42° East, a distance of 19.75 feet, marked T1N R35E S22 BT. A 22" Douglas Fir bears South, a distance of 12.55 feet, marked T1N R35E S21 BT. A 14" Western Larch bears North 59° West, a distance of 29.55 feet, marked T1N R35E S16 BT.

Set steel fencepost approximately 1' South

I hereby certify that the corner was monumented June 23, 2017. Witness: Kyle Tucker

REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON JEFFREY S. HSU 83571

Renewal Date: June 30, 2019

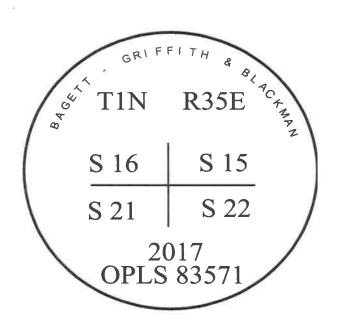

I used a steel tape and magnetic compass in the establishment of the bearing trees. Magnetic declination used was 13° East. Bearings are to a brass washer marked OPLS 83571 in the lower blaze of the tree. Distance is to a spike set in the root crown of the side of the tree.