


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Currin and Noland under GLO contract dated May 4, 1887. Surveyor General field notes state:

Set basalt stone 16x10x8 ins. 12 ins in the ground for cor to secs 14, 15, 22 and 23, marked with 3 notches on S and 2 notches on E edges and raised mound of stone over it. Pits impracticable.

T 1 N R 35 E N-17

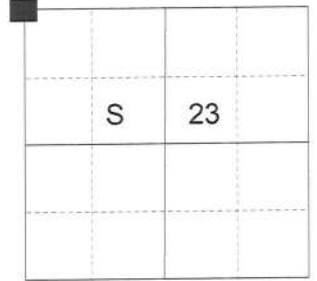

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found remnants of a mound of stone, evidenced by partially buried stones in a deliberate fashion. No marks could be found on any of the stones. Position is harmonious with corners, as determined by survey.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the found mound of stone position, I set a 2 1/2" x 30" aluminum pipe monument, with 2 1/2" aluminum cap attached, marked as shown below, 8" in the ground, to bedrock, in a mound of stone, 3 ft. in diameter, from which:

NEW BEARING OBJECTS:


- A 5/8" x 15" rebar bears North 61°59' East, a distance of 15.01 feet, with 1 1/2" aluminum cap marked BGB SURVEY MARKER NE RP.
- A 5/8" x 15" rebar bears South 47°06' East, a distance of 17.57 feet, with 1 1/2" aluminum cap marked BGB SURVEY MARKER SE RP.
- A 5/8" x 15" rebar bears South 47°29' West, a distance of 12.07 feet, with 1 1/2" aluminum cap marked BGB SURVEY MARKER SW RP.
- A 5/8" x 15" rebar bears North 50°28' West, a distance of 22.43 feet, with 1 1/2" aluminum cap marked BGB SURVEY MARKER NW RP.

Set a steel fencepost approximately 2 ft. South of corner monument. Corner falls on a Southwest facing slope.

I hereby certify that this monument was set May 5, 2016.



Renewal Date: June 30, 2017

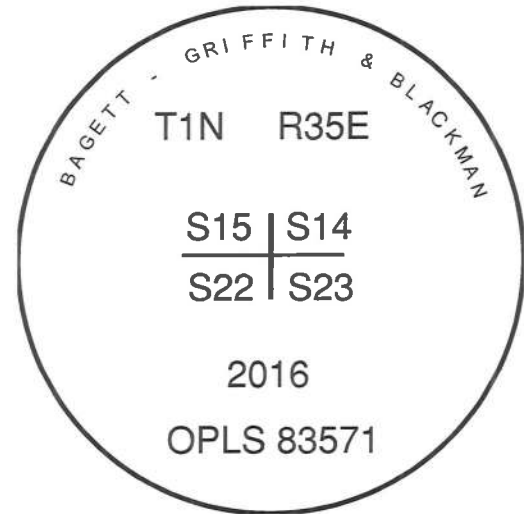

I used a Leica RTK GPS in the establishment of the accessories. Basis of bearing is as per survey for Hancock Forest Management, dated May 2016.

RECEIVED BY
 Umatilla County Surveyor
 Date: 5/10/16
 Rec'd By: CT
 No.: 16-058-13

N-17