

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 07/10/06

CORNER DESIGNATION: T1S., R35E., W.M, N-7, The North One-Quarter Corner of Section 20.

PREVIOUS RENEWALS/SURVEYS ETC.:

Original survey performed by James P. Currin and James E. Noland under their special contract dated May 4th 1887. Amended original notes state: Set a post 3 feet long, 3 ins. square, 24" in the ground for 1/4 Sec. Cor. marked 1/4 S on North face from which a fir 20 ins. in diam. bears N 42°E dist. 14 lks. Mkd. 1/4 S BT; A fir 20 ins. in diam. bears N 42° W dist. 33 lks. Mkd. 1/4 S BT.

MONUMENT AND ACCESSORIES FOUND:

None. The area has been extensively logged. The corner was surveyed through without corner recovery on Survey No. M-46-C, (1975 by Chris Palmer) and on Survey No. M-34-A, (1976 by Ed Herbes). There are several large Douglas fir stumps in the area old enough to be bearing trees, but they are cut below where the original surveyor would have made his scribes and blazes.

MONUMENT MARKING DETAIL:

T1S R35E
1 S17
4 S20
2006
PLS 1106

MONUMENT SET:

Re-established corner by single proportionate measure between the recovered Northwest and Northeast corners of Section 20. At reestablished corner position, set a 2 3/8" brass cap on 1 1/4" galvanized iron pipe, 24" in the ground and surrounded with mound of earth and stone. Monument marked as shown in monument marking detail.

New accessories:

A 10" dia. white fir bears North 09° East, 16.8 feet, scribed "1/4 S17 BT" on single blaze. Nailed a 3/4" brass washer stamped "PLS 1106" to the blaze.

A 60 penny spike driven in the top of a 38" dia. pitched up Douglas fir stump cut 1 foot above ground level bears North 43 1/2° East, 35.6 feet.

A 60 penny spike driven in the top of a 15" dia. Douglas fir stump cut 1 foot above ground level bears South 38° East, 45.0 feet.

A 8" dia. white fir bears South 06° East, 16.3 feet, scribed "1/4 S20 BT" on single blaze. Nailed a 3/4" brass washer stamped "PLS 1106" to the blaze.

Attached bearing object signs to all accessories. Set steel fence post with witness sign attached 3 feet East of monument.

LOCATION AND COMMENTS: Corner is located 150' +/- West of the bottom of a shallow draw running Northwesterly. There is a East-West blaze line 8 feet North of the corner, and a blaze line running South, 10 feet West of the corner.

FIRM: William R. Wells, PLS
P.O. Box 1696
Pendleton, OR 97801


COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT
1S35EN7



William R. Wells

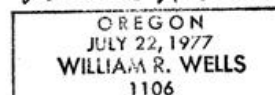

renews 6-30-08

06-469-B