

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


V-21

History of original corner establishment:

This corner was established by Rufus S. Moore under contract number 451 on October 3, 1882 as follows:

Set post for corner to sections 25, 26, 35 and 36, from which:

- A 15" fir bears N48°E, 23 links (15.18 feet) scribed T1S R35E S25 BT.
- A 16" fir bears N55°W, 9 links (5.94 feet) scribed T1S R35E S26 BT.
- An 8" fir bears S61°W, 36 links (23.76 feet) scribed T1S R35E S35 BT.
- A 12" fir bears S64°E, 12 links (7.92 feet) scribed T1S R35E S36 BT.

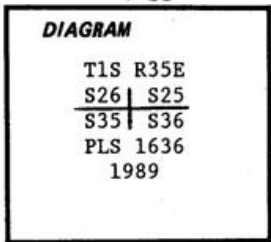

Description of corner evidence found:

I visited this corner on June 24, 1981 and found and recorded the following original corner evidence: A root hole with the remains of the tree lying alongside with visible scribes "R35E S35 BT". This root hole fit the location of the southwest bearing tree. I also found root holes which fit the location of the northeast and southeast bearing trees. A decayed log with a healed blaze was lying alongside the root hole to the southeast. A fence corner was at the approximate corner point. At that time I nailed a Bearing Tree sign to the recovered scribed piece of bearing tree. Today I find the following: The bearing tree sign I placed in 1981 is lying north of the root hole. The scribed bearing tree remains I recovered in 1981 are gone. A root hole bears S61°W, 23.8 feet. A root hole bears N48°E, 15.2 feet. A root hole with a decayed log lying alongside with a healed blaze, no scribe marks remain, bears S64°E, 7.9 feet. The location of the original northwest bearing tree has been cleared with heavy machinery for fence construction and nothing remains of this tree. A fence corner with fences projecting north and west bears N65°W, 3.0 feet.

Description of monument and accessories established to perpetuate the original location of this corner:

At the point for the corner determined by reference to the original bearing tree remains, I set a 2 1/2" by 30" aluminum pipe, with a 2 1/2 inch aluminum cap attached, 26" into the ground. The cap is marked as shown in the diagram above. From which new accessories:

- A 14" white fir bears S32°W, 25.1 feet scribed "T1S R35E S35 BT"
 - A 22" douglas-fir bears S1°E, 33.4 feet scribed "T1S R35E S36 BT"
 - A 15" white fir bears N61°E, 36.4 feet scribed "T1S R35E S25 BT"
 - A 13" western larch bears N29°W, 36.1 feet scribed "T1S R35E S26 BT"
- All four bearing trees are scribed on a single blaze and also have a 3/4 inch brass washer, marked "PLS 1636", nailed flush to the lower portion of the blaze. Each tree additionally has a 54-3 (bearing tree) and a 54-9 (land survey monument) sign attached.

I hereby certify the above corner point was perpetuated as hereon described on November 22, 1989. Witness: Caroline Davis. De: 19 1/2°E.



Office of _____ County Surveyor _____ County of _____ Umatilla
 State of _____ Oregon _____, I hereby certify that the within instrument was filed in this office
 for record on the 22nd day of November, 1989
David H. Kumbien by Kathleen Kumbien
 (COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY
 Umatilla County Surveyor
 Date 11-89
 Rec'd by KA
 No. 89-113-R