


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

A-25

History of original corner establishment:

Corner was originally established by Jacob C. Cooper, under GLO Contract No. 397, dated July 1, 1881. Surveyor General record states: Intersect the base line 21.90 chs E. of cor to Tps 1 N. Rs 36 and 37 E. Set post 4 1/2 ft. long 4 ins square 24 ins in the ground for closing cor to Tps 1 S. Rs 36 and 37 E. marked CC, T1S on the S. R37E S6 on the E. R36E S1 on the West faces with 6 notches on the S, E and W faces. A tamarack 20 ins diam bears S65°W 17 lks dist marked T1S R36E S1 BT. A tamarack 13 ins diam bears S41°E 35 lks dist marked T1S R37E S6 BT. Resurveyed by Duane I. Griffith, OPLS 644 in 1989. His record states: Found a 10 ft. chunk of 14-16 inch diameter Western Larch with blaze and chop marks with very faint scribes visible. Impossible to determine the exact origin of the tree, as the area has been violently torn up by logging. History of corner record continued on page 2.

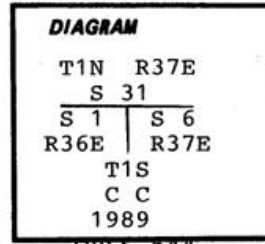

Description of corner evidence found:

Found 2 1/2" aluminum pipe with a 2 1/2" aluminum cap, marked as shown in corner diagram, from which:  
A 24" tamarack bears S 51 1/2° E - 187.5 feet, with scribing visible on partly healed blaze.  
A 24" fir bears S 12 3/4° E - 54.1 feet, with scribing visible on partly healed blaze.

Description of monument and accessories established to perpetuate the original location of this corner:

Set steel fence post ±5 feet South and West of monument, with 54-2 sign attached.

New bearing trees established:

A 25" tamarack bears S 20° E - 135.1 feet, scribed: T1S R37E S6 CC BT.  
An 8" white fir bears S 67 1/4° W - 21.1 feet, scribed: T1S R36E S1 CC BT.

Bearing trees have a brass washer stamped 'PLS 1106' nailed to the face of the blaze and signs 54-3 and 54-9 attached. Painted face of blaze red and 6" red band around each bearing tree.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on July 25, 1994.

Compass declination 18° East.

Sheet 1 of 2 (continued on page 2)

REGISTERED PROFESSIONAL LAND SURVEYOR

Wells-R. Wells  
OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

renews 12-31-94

Office of Surveyor County of Umatilla  
State of Oregon I hereby certify that the within instrument was filed in this office  
for record on the 7 day of December, 1994  
David H. Kline by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor

Date 12-94

Rec'd By KK


No. 94-170-B

\*GPO-591-971, 1988

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

A-25

History of original corner establishment:  
 History record continued from page 1.  
 I place this corner at the intersection of the base line between Townships 1 North and 1 South, and the projected East line of Section 1. This position is harmonious with the area of the found bearing tree, the spring branch call to the East, and also with the existing blaze line to the South. There is an excess along the base line of approximately 3 chains, which would make a true proportionate position for this corner in conflict with the existing conditions. At the above described corner position, I set a 2½" x 30" aluminum pipe with aluminum cap (marked as shown in the corner diagram), 30 inches in the ground, from which: New Bearing Trees: A 25 inch diameter Western Larch bears S55°E, 187.45 feet marked T1S R37E S6 CC BT. A 22 inch diameter Hemlock bears S15°E, 54.10 feet marked T1S R37E S6 CC BT.  
 See Map of Survey no. 89-101-B.  
 Description of corner evidence found:

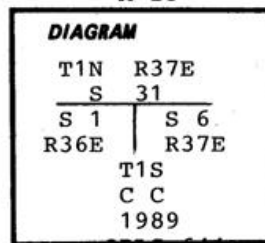

Page 2 of 2

Description of monument and accessories I established to perpetuate the original location of this corner:

REGISTERED PROFESSIONAL LAND SURVEYOR

William R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

Office of SURVEYOR County of Umatilla renews 12-31-94  
 State of Oregon I hereby certify that the within instrument was filed in this office  
 for record on the 31 day of December, 1994  
David H. Kline by \_\_\_\_\_  
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY  
 Umatilla County Surveyor  
 Date 12-94  
 Rec'd By KK  
 No. 94-170-B