


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

C-25

**History of original corner establishment:**

Corner was originally established by Jacob C. Cooper under GLO Contract No. 397, dated July 1, 1881. Surveyor General record states: Set post 3½ ft long 3 ins square 15 ins in the ground on the N side of ravine 20 ft above spring branch in dense timber for ¼ sec. cor. marked ¼S on E and W faces from which; A tamarack 14 ins diam bears S24°W 5 lks dist marked ¼S BT. A spruce 8 ins diam bears S10°E 16 lks dist marked ¼S BT. Range line resurveyed by Henry Meldrum under GLO Contract No. 450, dated June 11, 1882. Surveyor General record states: As the corners on the West boundary of this Township are not suitable for survey of T1S R37E. . .I am therefore compelled to resurvey it. 53.00 ch-The ¼ sec corner. (Meldrum does not call destroying marks referring to R37E). Corner remonumented from original GLO corner evidence in 1972 by Douglas M. Ferguson, OPLS 848. His record states:

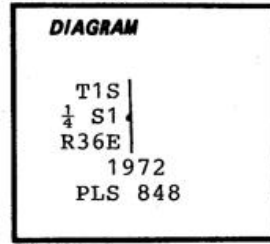

**Description of corner evidence found:**

Found a 2½" iron pipe with 3" brass cap marked as shown, in corner diagram, from which:  
 A 7" white fir bears N 69° W - 19.6 feet, live, but broken off, visible scribing.  
 A 19" spruce bears S 50 3/4° W - 20.3 feet, scribing visible.  
 A ±15" spruce bears S 4 3/4° E - 11.2 feet, dead and broken off.  
 A 16" tamarack, found by Griffith, lying loose on the ground, Southeasterly of corner, with scribing visible.

**Description of monument and accessories established to perpetuate the original location of this corner:**

Set steel fence posts ± 5 feet North and South of monument with sign 54-2 attached.  
 New bearing trees established:  
 A 17" spruce bears S 40½° W - 51.7 feet, scribed: 1/4 S1 BT.  
 A 22" ponderosa pine bears S 80½° W - 71.2 feet, scribed: 1/4 S1 BT.  
 A 20" spruce bears N 81½° W - 57.9 feet, scribed: 1/4 S1 BT.

Bearing trees have a brass washer stamped 'PLS 1106' nailed to the face of the blaze with signs 54-3 and 54-9 attached. Painted face of blaze red and 6" red band around each bearing tree.

I hereby certify that the above corner monument was properly maintained to U.S.F.S. standards by me on July 21, 1994.

Compass declination 18° East.

Sheet 1 of 2 (continued on page 2)

REGISTERED PROFESSIONAL LAND SURVEYOR
---

*William R. Wells*

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106
---

*renews 12-31-94*

Office of Surveyor County of Umatilla  
 State of Oregon, I hereby certify that the within instrument was filed in this office  
 for record on the 7 day of December, 1994  
David H. Kline by \_\_\_\_\_  
 (COUNTY OFFICIAL) (DEPUTY)


RECEIVED BY  
 Umatilla County Surveyor  
 Date 12-94  
 Rec'd By KK  
 No. 94-170-B

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

C-25

History of original corner establishment:

History Record continued from page 1. Found remains of original post from ground level to a depth of approximately 15 in. Found a 16 in. tamarack, live in good condition, with scribing visible, bearing S24°W 3.8 ft. from original post. Found a 12 in. spruce, live in good condition, with scribing visible, bearing S11°E 11.2 ft. dist. from the original post. Accepted post as corner position. Set 30 in. x 2 1/2 in. iron pipe with 3 in. brass cap (marked as shown in corner diagram) 26 in in the ground for the East 1/4 Corner to Section 1. Corner resurveyed by Duane I. Griffith, OPLS 644, July 30, 1989. His record states: Found a 3" brass cap monument (marked as shown in corner diagram) ORIGINAL BEARING TREES: Found a 14 inch diameter Spruce S11°E, 11.2 feet, live but sickly with scribes visible. Found a 16 inch diameter Western Larch S24°W, 3.8 feet, dead and down with scribes visible. Found a steel fencepost approximately 5 feet East with a Land

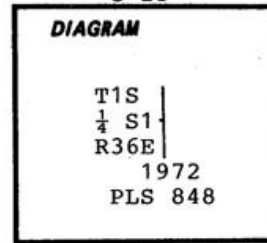

Description of corner evidence found: Survey Monument sign attached. Distance to the original BTs is to the estimated face of blaze. See Certified Land Record no. H-156-R. New Bearing Trees: A 18 inch diameter Spruce bears S54°W, 20.31 feet marked 1/4 S1 BT A 8 inch diameter White Fir bears N66°W, 19.57 feet marked 1/4 S1 BT

Description of monument and accessories established to perpetuate the original location of this corner:

Sheet 2 of 2

REGISTERED PROFESSIONAL LAND SURVEYOR

Will. R. Wells

OREGON JULY 22, 1977 WILLIAM R. WELLS 1106

renews 12-31-94

Office of... Surveyor... County of... Umatilla... State of... Oregon... I hereby certify that the within instrument was filed in this office for record on the... 2... day of... December... 1994... (COUNTY OFFICIAL) by... (DEPUTY)

Form R6-7100-57 (9/71)

RECEIVED BY

Umatilla County Surveyor

Date 12-94

Rec'd By KK

No. 94-170-B

\*GPO-591-971, 1988