


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Quarter corner to Sections 10 and 15, T.2N, R.31E., WM. Index: J-15

History of original corner establishment:  
Corner originally set by Josiah Burnett in contract 92 dated 1860. His record reads: 40.25 Set post for 1/4 Sec. corner, drove charred stake and raised mound with trench as per instructions.

DIAGRAM

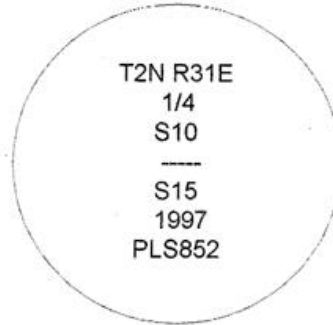

In 1897, C. B. Wade surveyed in sections 15 and 16 and recorded his survey as Survey No.92 in book 1 of Umatilla County Surveys. His record reads: 40.38 Set stone for 1/4 sec cor bet secs 10 and 15 with md & pits.

Evidence Found: Found 18" long stone 8" by 10" firmly set vertically in ground with 5" top exposed in mound of stone. The stone had a 1/4 chiseled on the north vertical face. Remains of old fences run east, west, and north. A draw bottom running north lies 2.75 chains east.

Description of monument and accessories I established to perpetuate the original location of this corner:

I set a 1.25" O.D. x 30" galvanized iron pipe with 2.25" brass cap stamped as shown in the diagram above. The pipe was set 24" in the ground. Constructed stone collar around the monument. Set a 6' steel fence post with Umatilla County Land Survey Monument sign attached from which:


- a rebar bears S1°22'35"E, 45.18';
- a rebar bears S89°03'39"E, 36.81';
- a rebar bears N2°05'24"W, 48.41';
- a rebar bears N88°32'43"W, 36.52'.

Each rebar is 5/8" x 24" and has a 1.25" diameter red plastic cap, stamped ORLS0852 and WAL513922.

The bearings are true based on GPS observations.

This work was done May 1, 1997.

Office of \_\_\_\_\_ County of \_\_\_\_\_  
 State of \_\_\_\_\_, I hereby certify that the within instrument was filed  
 in this office for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_.  
 \_\_\_\_\_ by \_\_\_\_\_  
 ( COUNTY OFFICIAL ) ( DEPUTY )

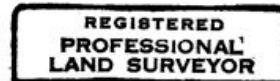

David L. Haddock



RECEIVED BY  
 Umatilla County Surveyor  
 Date 6-98  
 Rec'd By KK  
 No. 98-121-B  
36