

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T 2N , R 32E. , W.M.

Corner Code No. A-9


Note: Monument marked as shown below

History of original corner establishment:

This corner was originally established by D. Thompson, U.S. Deputy Surveyor, under Contract No. 106, dated August 16, 1864. The original notes state that at the corner a 18" by 10" by 8" stone was set for the corner.

In 1900, during County Survey No. 142, John Kibrell states that he recovered the corner when he reestablished the 1/4 corner common to Sections 5 & 4. Kibrell does not state what was found for the corner monument.

A concrete monument is called for on City of Pendleton Map No. 11-7711 in 1974, and on Map No. R-23-B, as surveyed by Terry Haaby in 1980.

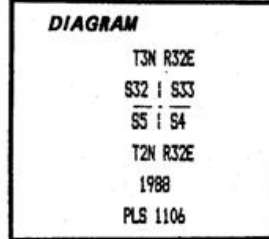

Corner No.
Compass Declination: 18.0

Description of corner evidence found:

Found a P.K. nail embedded in concrete for the corner point. There are 2" by 2" wood hubs north and west of the corner point. The concrete monument called for in previous surveys (a 10" by 8" by 6" long concrete post), has been broken off during fairly recent fence construction and is located S.E. of the corner point about 60'. Since the P.K. nail and wood hubs indicate that the concrete monument was referenced by a surveyor, I made inquiries of area surveyors but found no one who could remember referencing out the concrete monument. The P.K. nail corner location was verified by surveying to established corner monuments east, west and south of the corner point, and was accepted as the position for this corner.

Description of monument and accessories established to perpetuate the original location of this corner:

At the position of the found P.K. nail, which was embedded in a large block of concrete which used to support the concrete post monument, I set a 3" brass disc in mortar to remonument the corner position.

The new corner monument is referenced as follows. From the new monument:

A 1 1/2" yellow plastic cap marked "W.R. Wells, PLS 1106", set on a 5/8" by 30" iron rod bears N85°E 15.58'. Attached witness corner and bearing object sign to a steel fence post next to the reference monument. The reference monument falls in a east-west fence line.

A 1 1/2" aluminum cap, marked as shown, set on a 5/8" by 30" iron rod, bears S9°W 13.20'. Set steel fence post next to the reference monument and attached witness corner and bearing object signs. The reference monument falls in a north-south fence.

A 2 1/2" diameter round fence post set in concrete bears N39°W 1.72. The measurement was taken to the point where the fence post goes into the concrete. Attached witness corner sign to this fence post. Fences go east and south from this fence corner.

The aluminum cap on the reference monument is marked:

REGISTERED PROFESSIONAL LAND SURVEYOR <i>William R. Wells</i> OREGON JULY 22, 1977 WILLIAM R. WELLS 1106



Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)