

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 4/14/94

CORNER DESIGNATION: T-13, East 1/4 corner Section 28, T2N., R32E., W.M.

PREVIOUS RENEWALS/SURVEYS, ETC.: Most recent approved GLO Survey was made by James P. Currin and James Noland, under Special Contract dated May 4, 1887. They set a stone 10 x 8 x 6 ins. in bed of creek for 1/4 sec. cor. marked 1/4 on W. face. Set stone 8 x 10 x 12 ins. on W. bank N. 80° W. 60 lks. dist. for witness cor. marked 1/4 W.C. on W. face, from which a Cottonwood 18 in. diam. bears S.12°E. 50 lks. dist. marked 1/4 S.W.C.B.T., and a Cottonwood 12 ins. diam. bears N.75°W. 1.85 chs dist. marked 1/4 S.W.C.B.T. This corner was recovered and referenced in County Survey No. 62, (Record of Private Surveys), in 1894, by J.C. Arnold, County Surveyor.

MONUMENT AND ACCESSORIES FOUND: None. Area has been washed by creek runoff and creek channel has been worked.

MONUMENT MARKING DETAIL:

T2N R32E
1/4
S28 | S27
1994
PLS 1106

MONUMENT SET: Corner position was re-established by single proportion measurement between the Northeast and Southeast corners of Section 28. At position determined by survey, set a 2 1/2" brass cap on a 1 1/4" x 30" galvanized iron pipe, 30" in the ground, with a mound of stone to the cap, (marked as shown in the monument detail).

New Accessories:


Set steel fence post 1.3 feet North of monument with witness sign attached.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 35° E- 17.2 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 35° E- 48.9 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 19° W- 50.1 feet.
A 5/8" x 30" iron pin with yellow plastic cap stamped "OR PLS 1106-WA PLS 17372" bears N 61° W- 46.6 feet.
Attached bearing object signs to each iron pin. Set steel fence posts near iron pins with witness signs attached.

LOCATION & COMMENTS: Corner falls in North edge of creekbed at approximate water line.

COMPASS DECLINATION: 18° East.
FIRM/AGENCY: William R. Wells, PLS
P.O. Box 1696
Pendleton, Oregon 97801

Surveyor's Seal

Party Chief: Robert D. English
Notes: Robert D. English
Witness: F. Scot Munro

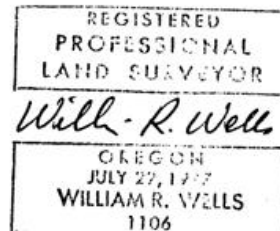

renews 12-21-94