


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

T - 21
DIAGRAM

History of original corner establishment:

The original corner was established by George S. Pershin on September 3, 1878, under GLO contract No. 293, as follows:

Set stone, 14" x 10" x 8", on level for 1/4 section corner.

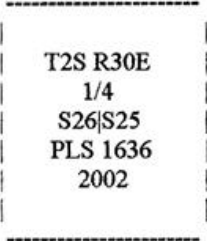

Original corner evidence recovered:

Found the original corner stone loosely set in a mound of stones. The corner stone is 16" x 12" x 8" and is plainly marked "1/4" on one face.

Monument and accessories established to perpetuate the original position of this corner:

In place of the original corner stone, I set a 1" x 30" flared, galvanized iron pipe 18" into the ground to bedrock. A 2 1/2" brass cap attached to the top of the pipe is marked as shown in the diagram above. I bury the corner stone along the south side of the pipe and build a mound of stones around the pipe, from which:

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 NE", attached at ground level, bears N1° 30' E, 133.4 feet.

A 5/8" x 36" iron rod set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 SE", attached at ground level, bears S88° 30' E, 43.3 feet.

A 5/8" x 36" iron rod set 34" into the ground with a 3/4" brass washer, marked "PLS 1636 SW", attached at ground level, bears S87° W, 65.0 feet.

A 5/8" x 24" iron rod set 19" into the ground with a 3/4" brass washer, marked "PLS 1636 NW", attached at ground level, bears N55°W, 104.8 feet.

A "witness post" sign is nailed to a wooden fence post in a fence corner with fences projecting north, east and west.

I hereby certify the above corner point was perpetuated as hereon described on January 16, 2002. Magnetic declination set in compass: 20° E.

Renews June 30, 2003

Recorded at the office of County Surveyor, County of Umatilla, State of Oregon, on: _____

RECEIVED BY
 Umatilla County Surveyor
 Date 2-02
 Rec'd by KK
 No. 02-35-R