

**OREGON CORNER RESTORATION FORM**

Section 2 Township 2S Range 31E  
 County Umatilla Date: March 22, 2011

Corner Designation: 2S31A19

Condition Report Only  
 Not found  
 Remonumented  
 Unrecorded  
 Surveyed in  
 Referenced out

Quarter corner common to S35, T1S, and S2, T2S, R31E  
 W.M., Umatilla County, Oregon.


Previous Renewals / Surveys, etc.

Corner originally set by David P. Thompson under contract No. 106 dated August 16, 1864. His record reads: Set post for 1/4 Sec. Cor. in mound of earth with a charred stake, pits, trench &c. as per instructions.

Monument and Accessories found: ( condition and source )


I found the charred point of the stake in a mound of stone at a fence corner with fences running east and southwest.

**DIAGRAM**

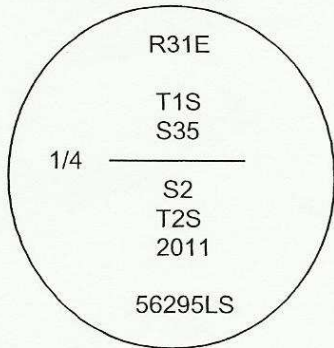

⊗ = Set Brass Cap  
 ● = Iron Rebar Reference

**SKETCH**

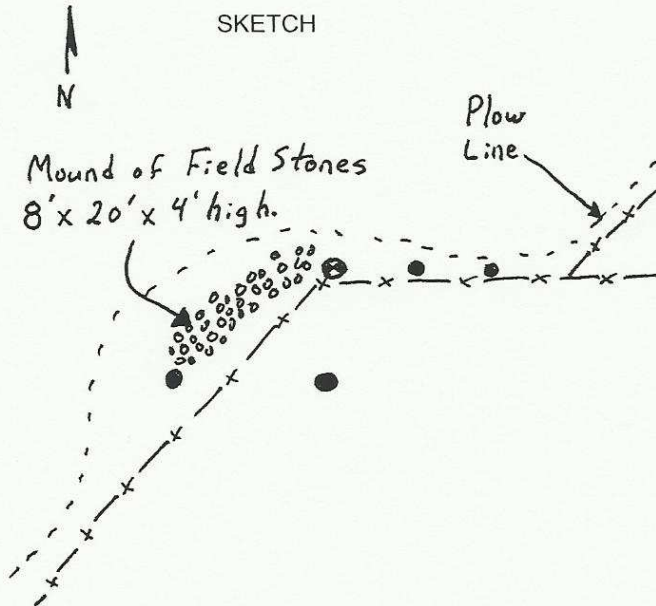

**MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)**

At the corner point determined by the charred wood I set a 2 3/8" brass cap on a 1 1/2" x 30" galvanized iron pipe 28" in the ground and build a small mound of stone around it.

For references, I set four 5/8" by 20" rebars with 1.25" orange plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears S51°22'21"W, 18.87 feet at the south end of a large pile of field stones;
- an iron rebar bears S88°57'38"E, 67.97 feet under the existing fence;
- an iron rebar bears S88°31'46"E, 28.15 feet under the existing fence;
- an iron rebar bears S12°01'27"E, 53.75 feet;

The monument and references were tied using a Trimble R7/R8 RTK GPS.

Location and comments

Compass Declination

Surveyors Seal

RECEIVED BY:  
 Umatilla County Surveyor  
 Date: \_\_\_\_\_  
 Rec'd By: \_\_\_\_\_  
 No. 11-112-c

Firm / Agency  
 Witness Tree Surveying  
 Address  
 P.O. Box G  
 Pilot Rock, Or. 97868  
 Party Chief  
 Stephen K, Haddock

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Stephen K. Haddock*

OREGON  
 JULY 9, 2001  
 STEPHEN K. HADDOCK  
 56295LS

RENEWAL DATE 6-30-13