


History of original corner establishment:

The original corner was established by Daniel Chaplin on November 20, 1864, under GLO contract No. 107, as follows:

Set stone, 18" x 17" x 8", for 1/4 section corner.

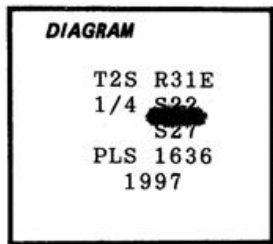

Description of corner evidence found:

The original corner stone is solidly set 6" in the ground in a mound of stones. The stone is 18" x 16" x 7" and is plainly marked "1/4" on the north face.

Description of monument and accessories established to perpetuate the original location of this corner:

Moving the corner stone aside, I set in it's place a 1 1/2" x 30" iron pipe 26" into the ground. A 2 1/2" brass cap attached is marked as shown in the diagram above. I bury the corner stone along the northwest side of the pipe and build a mound of stones around the pipe to the cap, from which:

A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 S22 NE", attached at ground level, bears N70°30'E, 95.2 feet.

A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 S27 SE", attached at ground level, bears S32°E, 113.2 feet.

A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 S27 SW", attached at ground level, bears S73°30'W, 149.8 feet.

A 5/8" x 36" iron rod, set 35" into the ground with a 3/4" brass washer, marked "PLS 1636 S22 NW", attached at ground level, bears N27°W, 110.5 feet.

I hereby certify the above corner point was perpetuated as hereon described on April 14, 1997. Magnetic declination: 20°E.

Witnesses: Milena Gaylord
Jacqueline Franco

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON
JULY 14, 1978
DENNIS L. GAYLORD
1636

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

(COUNTY OFFICIAL)

(DEPUTY)

RECEIVED BY

Wasatch County Surveyor

Date 4-97
Swd'd By KK
No. 97-66-R