

OREGON CORNER RESTORATION FORM

Section 28 Township 2S Range 33E
 County Umatilla Date: May 17, 2000

Corner Designation: 2S33V13

Corner to sections 27, 28, 33, and 34, T2S, R33E,
 W.M., Umatilla County, Oregon.

Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out


Previous Renewals / Surveys, etc.

Corner originally set by John C. Arnold under contract #551 dated March 19, 1890.

His record reads: Set basalt stone, 12 x 8 x 6 ins., 8 ins. in ground for cor. to secs. 27, 28, 33, & 34, marked with 1 notch on S. and 3 notches on E. faces. Raised mound of stone 1 1/2 ft. high by 4 1/2 ft. base over corner.

Monument and Accessories found: (condition and source)

The original stone plainly chisled and firmly in place in a small mound of stone.

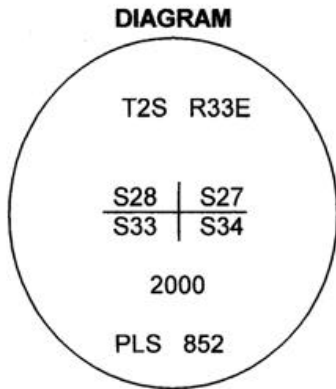

⊗ = Brass cap
 • = Reference
 ■ = Guard post

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

Set a 1 1/2" x 30" galvanized iron pipe with a 2 1/4" brass cap stamped as shown in the diagram above at the position of the original stone. Buried the stone along side. Set a 6' steel post with a county monument sign attached along side.

For references, I set four, 5/8" by 24" rebars with 1.25" red plastic caps stamped ORLS 852 and WAL5 13922 as described below:

- an iron rebar bears N28°53'05"W, 26.67 feet;
- an iron rebar bears N46°06'26"E, 26.30 feet;
- an iron rebar bears S45°44'19"W, 32.70 feet;
- an iron rebar bears S26°57'42"E, 27.99 feet;

The monument and references were tied using a LIECA system 300 RTK GPS.

Location and comments

Compass Declination

Surveyors Seal

RECEIVED BY:
Umatilla County Surveyor
 Date: 7-00
 Rec'd By: KK
 No. 00-156-C

Firm / Agency
 Haddock Surveying
 Address
 P.O. Box 1574
 Pendleton, Or. 97801
 Party Chief
 Stephen K, Haddock

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

David L. Haddock

OREGON
 JULY 12, 1969
 DAVID L. HADDOCK
 852