

**OREGON CORNER RESTORATION FORM**

Section 18 Township 3N  
County Umatilla Date: 09/15/09

Range 29E

Corner Designation: 3N29L1

1/4 corner common to sections 18, T3NR29E, 13,  
T3NR28E.

_____	Condition Report Only
_____X_____	Not Found
_____	Remonumented
_____	Unrecorded
_____X_____	Surveyed In
_____X_____	Referenced Out


**Previous Renewals / Surveys, etc.**

Originally Surveyed by Gates in 1859. He set a post in a mound of earth.


**Monuments and Accessories Found: (Condition and Source)**

None.

**Diagram**

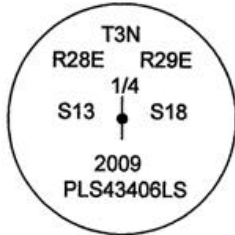

**Sketch**

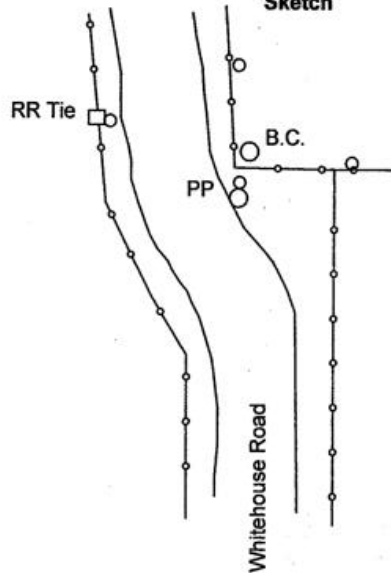

NAD 83/91  
OREGON STATE PLANE NORTH  
INTERNATIONAL FEET

N758494.22  
E8521615.20

LAT - 45° 44' 25.22521" N  
LON - 119° 14' 54.60781" W

**Monument (s) Set (Procedures and Description)**

Set a 1 1/4" X 30" galvanized iron pipe with a 2 1/2" Brass cap, by single proportion between 2 found monuments on the West line of T3N29E. (N1 & R1)

**References Set:**

- A 5/8" Iron rebar w/rpc #43406 under the fence lies N 2°15' W, 41.17'.
- A 5/8" Iron rebar w/rpc #43406 under the fence lies S 82°45' E, 38.92'.
- A pk-nail w/ brass washer #43406 on a power pole lies S 22°30' W, 17.31'.
- A pk nail w/brass washer #43406 on a RR Tie fence post lies N 76° W, 50.21'.

**Location and Comments**

From the intersection of Hwy. 320 and Whitehouse Road, go 1.00 mile North.

**Compass Declination**  
17° E

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert D. English*  
OREGON  
JANUARY 11, 2005  
ROBERT DOUGLAS ENGLISH  
43406LS

RENEWAL DATE: 12/31/09

**RECEIVED BY:**

Date: 1-11  
Rec'd By: RE  
No. 11-14-R

**Firm / Agency**

Survey One, LLC.  
P.O. Box 382  
Pendleton, OR 97801  
(541) 276-2055