

OREGON CORNER RESTORATION FORM

SECTION 35 TOWNSHIP 4 NORTH RANGE 29 EAST Z-19
COUNTY : UMATILLA DATE 8-98

CORNER DESIGNATION

SOUTH 1/4

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNCOVERED
 SURVEYED IN
 REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.


ORIGINALLY SURVEYED IN 1859 BY GATES UNDER CONTRACT #84. HE SET A POST IN A MOUND OF DIRT.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

NOTHING

MONUMENT DETAIL

SKETCH

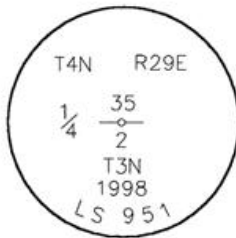

MONUMENT SET (PROCEDURES AND DESCRIPTION)

BY SINGLE PROPORTION I SET A 1" X 30" IRON PIPE WITH A 2 3/8" BRASS CAP STAMPED AS ABOVE, 4" BELOW THE SURFACE OF A GRAVELED ROAD.

NEW ACCESSORIES FROM WHICH

AN ALUMINUM TAG #951 ON A POWER POLE LIES N 71°.21'20" E, 32.91 FEET.
AN ALUMINUM TAG #951 ON A RXR TIE FENCE CORNER LIES S 16°.24'09" E, 41.69 FEET.
A 5/8" X 30" IRON REBAR WITH PLASTIC CAP #951 LIES S 17°.24'09" E, 39.85 FEET.
A 5/8" X 30" IRON REBAR AND PLASTIC CAP #951 LIES N 0°.15'19" W, 10.48 FEET.

LOCATION AND COMMENTS

COMPASS DEC.

SURVEYOR'S SEAL

FIRM/AGENCY
EDWARDS SURVEYING
P.O. BOX 763
HERMISTON, OREGON 97838
97838

PARTY CHIEF
D. EDWARDS

NOTES

WITNESS
CURTIS J FAVOREL

RECEIVED BY
Umatilla County Surveyor
Date 10-98
Rec'd By KK
No. 98-213-C

REGISTERED
PROFESSIONAL
LAND SURVEYOR

G. Dennis Edwards

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
951
RENEWS 12/31/99