

OREGON CORNER RESTORATION FORM

Section 2,3 Township 3N
County Umatilla Date: 08/12/10

Range 29E

Corner Designation: 3N29C17

Corner common to sections 2,3 T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out



Previous Renewals / Surveys, etc.

Originally Surveyed by Gates. He set a post in a mound of earth in 1859.

Monuments and Accessories Found: (Condition and Source)

None.

Diagram

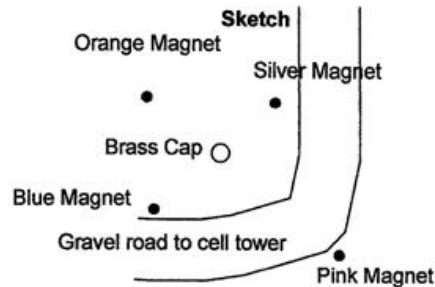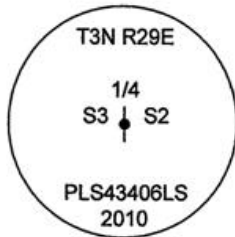

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N769608.33
E8543133.33

LAT - 45° 46' 11.53229" N
LON - 119° 09' 48.64171" W

Monument (s) Set (Procedures and Description)

A 1 1/4" x 30" galvanized iron pipe with a 2 1/2" brass capped monument 18" below the surface, stamped as shown above.

References Set: "Deep One" magnets by Berntsen.

- An Orange magnet 23" deep lies N 38°40' W, 14.40'.
- A Silver magnet 22" deep lies N 42° E, 14.15'.
- A Pink magnet 22" deep lies S 25°30' E, 29.70'.
- A Blue magnet 22" deep lies S 48° W, 14.14'.

Location and Comments

Compass Declination
17° E

Surveyors Seal

RECEIVED BY:

Date: 8-10
 Rec'd By: KE
 No. 10-135-R

Firm / Agency

Survey One, LLC.
 P.O. Box 382
 Pendleton, OR 97801
 (541) 276-2055

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Robert D. English
 OREGON
 JANUARY 11, 2005
 ROBERT DOUGLAS ENGLISH
 43406LS

RENEWAL DATE: 12/31/11