

**OREGON CORNER RESTORATION FORM**

Section 10  
County Umatilla

Township 3N  
Date: 08/31/09

Range 29E

Corner Designation: 3N29E13

Corner common to sections 3,4,9 and 10 T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out


**Previous Renewals / Surveys, etc.**

Originally Surveyed by N.H. Gates in 1859. He set a post in a mound of earth.  
 Zahner remonumented with a Granite rock 6"x13"x18" in private survey Book 1, Page 103.  
 D. Haddock computed the location under survey 98-155-C.  
 S. Haddock monumented w/ a 1 3/4" x 30" galvanized iron pipe w/ a 2 1/2" B.C. based on D. Haddock survey.


**Monuments and Accessories Found: (Condition and Source)**

Found A 2 1/4" B.C.  
 Found a 5/8" Iron rebar w/opc #56295 lies S 9°30' E, 43.62'.  
 Found a 1/2" Iron rebar w/rpc "DEA Control" lies N 42°15' E, 7.43'.  
 Found a 5/8" Iron rebar w/opc #56295 lies N 81° E, 39.29'.  
 Found an "X" cut into the southeast lifting eye of the irrigation pump lies N 66°30' W, 92.69'.

Diagram

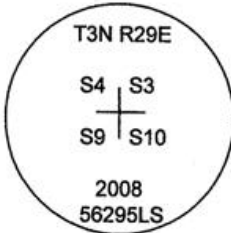

Sketch

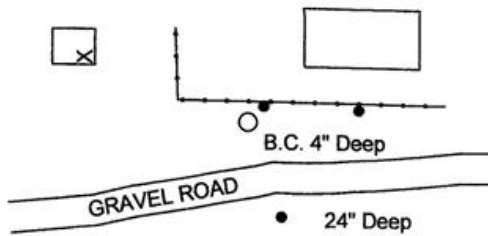

NAD 83/91  
 OREGON STATE PLANE NORTH  
 INTERNATIONAL FEET

N766833.67  
 E8537967.42  
 LAT - 45° 45' 44.98425" N  
 LON - 119° 11' 02.15455" W

**Monument (s) Set (Procedures and Description)**

None.

**References Set:**

None.

**Location and Comments**

The corner is .5 miles south of the intersection of Irwin Rd. and S. Ash Rd, on S. Ash Rd., and .5 miles east on a gravel road.

**Compass Declination**

17° E

**Surveyors Seal**

REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR

*Robert D. English*  
 OREGON  
 JANUARY 11, 2005  
 ROBERT DOUGLAS ENGLISH  
 43406LS

**RECEIVED BY:**

Date: 9-09  
 Rec'd By: JK  
 No. 09-146-R

**Firm / Agency**

Survey One, LLC.  
 P.O. Box 382  
 Pendleton, OR 97801  
 (541) 276-2055

RENEWAL DATE: 12/31/09