

**OREGON CORNER RESTORATION FORM**

Section 9,10 Township 3N  
County Umatilla Date: 05/21/10

Range 29E

Corner Designation: 3N29G13

Corner common to sections 9,10 T3NR29E.

Condition Report Only  
 Not Found  
 Remonumented  
 Unrecorded  
 Surveyed In  
 Referenced Out


**Previous Renewals / Surveys, etc.**

Originally Surveyed by Gates. He set a post in a mound of earth in 1859.

**Monuments and Accessories Found: (Condition and Source)**

None.

**Diagram**

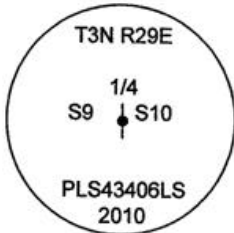

**Sketch**

Orange Magnet •

• Silver Magnet

○ 2.5" Brass Cap

NAD 83/91  
OREGON STATE PLANE NORTH  
INTERNATIONAL FEET

N764194.55  
E8538012.55  
LAT - 45° 45' 18.91983" N  
LON - 119° 11' 02.11753" W

Blue Magnet •

• Pink Magnet

**Monument (s) Set (Procedures and Description)**

A 1 1/2" x 30" Galvanized iron pipe w/ a 2 1/2" Brass capped monument 23" below the surface, stamped as shown above. Set by single proportion.

**References Set:** "Deep One" Magnets by Berntsen.

A Silver magnet, 18" deep lies N 62°30' E, 20.22'.

A Pink magnet, 18" deep lies S 6°45' W, 19.03'.

A Blue magnet, 18" deep lies S 69°10' W, 23.87'.

An Orange magnet, 18" deep lies N 8° W, 18.43'.

**Location and Comments**

The corner is North and East  
0.5 miles of the Echo Golf Course.

**Compass Declination**

17° E

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert Douglas English*  
OREGON  
JANUARY 11, 2005  
ROBERT DOUGLAS ENGLISH  
43406LS

**RECEIVED BY:**

Date: 6-10  
Rec'd By: KE  
No. 10-25-R

**Firm / Agency**

Survey One, LLC.  
P.O. Box 382  
Pendleton, OR 97801  
(541) 276-2055

RENEWAL DATE: 12/31/11