

OREGON CORNER RESTORATION FORM

Section 8
County Umatilla

Township 3N
Date: 03/11/10

Range 29E

Corner Designation: 3N29G8

Center East $\frac{1}{16}$ th Corner to section 8, T3NR29E.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals / Surveys, etc.

PLS 933 set a 2 1/2" Brass Cap in Survey #98-11-B.


Monuments and Accessories Found: (Condition and Source)

Found a 2 1/2" Brass Cap just East of the Echo Wastewater Settling Pond fence.

Diagram



Sketch

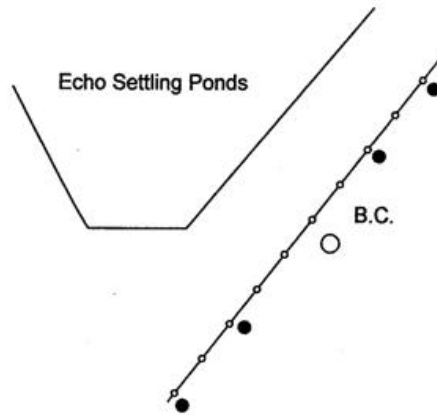

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N764054.55
E8531394.69

LAT - 45° 45' 18.59167495" N
LON - 119° 12' 35.47446847" W

Monument (s) Set (Procedures and Description)

None. Replaced Witness Corner sign on existing guard post.

References Set:

- A 5/8" Iron rebar, w/rpc, #43406 lies N 27°30' E, 18.35'.
- A 5/8" Iron rebar, w/rpc, #43406 lies S 56° W, 32.68'.
- A 5/8" Iron rebar, w/rpc, #43406 lies N 33° E, 27.96'.
- A 5/8" Iron rebar, w/rpc, #43406 lies S 70° W, 13.55'.

Location and Comments

The monument is near the Southeast corner of the Echo Settling Ponds. Accessible by Stanfield Irrigation District road along canal.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RECEIVED BY:

Date: 3-10
Rec'd By: RK
No. 10-24-R

Firm / Agency

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055

RENEWAL DATE: 12/31/11