

**OREGON CORNER RESTORATION FORM**

Section 22,23,26,27 Township 3N  
County Umatilla Date: 8/12/10  
Corner Designation: 3N29R17

Range 29E

Section corner common to T3NR29E sections 22,23,26, and 27.

- Condition Report Only
- Not Found
- Remonumented
- Unrecorded
- Surveyed In
- Referenced Out



**Previous Renewals / Surveys, etc.**

Originally Surveyed by Gates in 1859. He set a post in a mound of earth.

**Monuments and Accessories Found: (Condition and Source)**

None.

**Diagram**

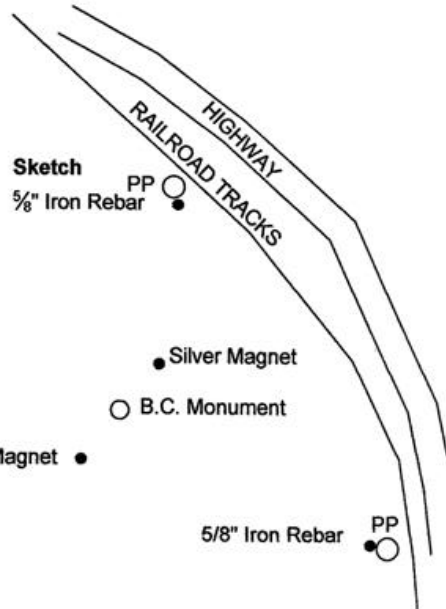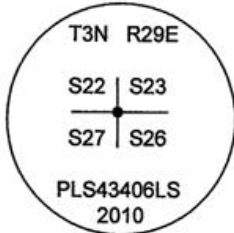

NAD 83/91  
OREGON STATE PLANE NORTH  
INTERNATIONAL FEET

N751085.81  
E8543575.55

LAT - 45° 43' 08.62817" N  
LON - 119° 09' 47.58044" W

**Monument (s) Set (Procedures and Description)**

1 1/4" x 30" galvanized iron pipe w/ a 2 1/2" Brass cap 20" below the surface, stamped as shown above. Corner re-established by Double Proportionate Method with weight given to existing fences.

**References Set:** "Deep One" magnets by Berntsen.

- A 5/8" x 30" Iron rebar w/rpc #43406LS lies N 39°40' W, 168.79'.
- A Silver magnet 20" deep lies N 11° E, 13.11'.
- A 5/8" x 30" Iron rebar w/rpc #43406LS lies S 64°30' E, 167.41'.
- A Blue magnet 19" deep lies S 7° E, 20.63'.

**Location and Comments**

Corner is located in the edge of an existing alfalfa field just N & W of Ramos residence.

**Compass Declination**  
17° E

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Robert D. English*  
OREGON  
JANUARY 11, 2005  
ROBERT DOUGLAS ENGLISH  
43406LS

**RECEIVED BY:**

Date: 8-10  
Rec'd By: RE  
No. 10-143-R

**Firm / Agency**

Survey One, LLC.  
P.O. Box 382  
Pendleton, OR 97801  
(541) 276-2055

RENEWAL DATE: 12/31/11