

OREGON CORNER RESTORATION FORM

Section 33 Township 3N
County Umatilla Date: 03/08/10

Range 29E

Corner Designation: 3N29Z11

1/4 Corner common to sections 33 T3NR29E, 4 T2NR29E.

_____	Condition Report Only
_____X	Not Found
_____X	Remonumented
_____	Unrecorded
_____X	Surveyed In
_____X	Referenced Out

Previous Renewals / Surveys, etc.


Originally Surveyed by David P. Thompson. He set a post in a mound of earth in 1859.

1 1/4" pipe set by Harris in Survey No. Q-76-B.

Monuments and Accessories Found: (Condition and Source)

Held distances called on Harris survey and found 1 1/4" pipe lying flat below the surface, in plowed field within a foot of it's called distance. Reset from Calls.

Diagram

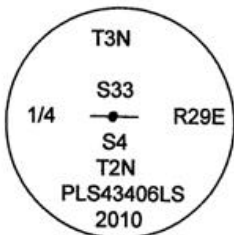

Sketch

- Orange Magnet
- Silver Magnet
- 2 1/2" BC
- 5/8" rebar with sfp ●x
- Blue Magnet

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N740234.22
E8535711.87

LAT - 45° 41' 22.75897980" N
LON - 119° 11' 40.02245027" W

Monument (s) Set (Procedures and Description)

Set a 1 1/8" x 30" Galvanized iron pipe with a 2 1/2" Brass cap, stamped as shown above. The monument is 18" deep. In farm field on Northeasterly facing slope.

References Set: "Deep One" magnets by Berntsen.

An Orange magnet, 18" deep lies N 58°10' W, 19.71'.

A Silver magnet, 18" deep lies N 11°20' E, 20.75'.

A 5/8"x30" Iron rebar w/ypc #43406 lies N 89°30' E, 60.00', on line, at edge of field.

A Blue magnet, 18" deep lies S 9°20' W, 17.18'.

Location and Comments

The corner is 2.0 miles East of the cattle guard at the South end of Snow Road along the East-West fence.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English
 OREGON
 JANUARY 41, 2005
 ROBERT DOUGLAS ENGLISH
 43406LS

RECEIVED BY:

Date: 3-10
 Rec'd By: KE
 No: 10-49-A

Firm / Agency

Survey One, LLC.
 P.O. Box 382
 Pendleton, OR 97801
 (541) 276-2055

RENEWAL DATE: 12/31/11