

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 2/26/16

CORNER DESIGNATION: P-21, The West Quarter Corner of Section 24, Township 3 North, Range 30 East, W.M.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally set by Wm. Campbell under Contract No. 95, dated September 19, 1860. Notes state; set a post for 1/4 sec. corner, drove a charred stake, raised mound of earth per instructions.

MONUMENT AND ACCESSORIES FOUND: None. Held a calculated position midway between Section corners on each side. See survey filed concurrently with this certificate for further information.

MONUMENT MARKING DETAIL:

T3N R30E
1
4
S23|S24
2016
PLS 54657

MONUMENT SET: At the calculated corner point set a 2 3/8" brass cap on 1 1/4"x30" galvanized iron pipe with top 12" below gravel road surface. Monument marked as shown in "Monument Marking Detail".

From which:


- A silver Deep-1 magnet buried 22" below ground in farmed field bears North 56° East, 31.6 feet.
 - A silver Deep-1 magnet buried 22" below ground in farmed field bears South 45° East, 30.9 feet.
 - A 5/8"x24" iron rebar with 1 1/4" purple plastic cap stamped "Wells Surveying PLS 54657", 2" above ground level at the Southeast corner post of a cyclone fence surrounding a tower guy wire bears South 35° West, 102.9 feet.
 - A silver Deep-1 magnet buried 22" below ground in farmed field bears North 49° West, 24.2 feet.
- Buried bearing object signs with magnets. Attached bearing object tag to rebar. Wired witness post sign to cyclone fence post by rebar.

LOCATION AND COMMENTS: Corner is located 1.5' +/- Westerly of the visual centerline of McClintock road running North-South. There is a farmed field line extending East, 25' Southerly of the monument, but it is new and has no historic significance. See map filed concurrently with this certificate for further information.

FIRM: Wells Surveying
P.O. Box 1696
Pendleton, OR 97801

COMPASS DECLINATION: 18° East Surveyor's Seal

/3N30P21

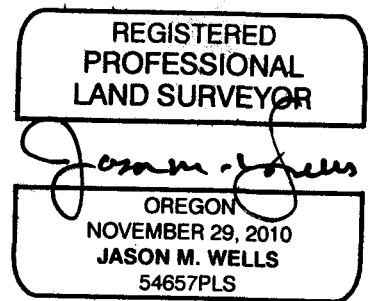

RENEWS: 6:30:16