

CORNER RESTORATION FORM

Township 3N Range 30E & 31E Section 12,13,7&18 County UMATILLA

State OREGON Date 3-10-2015 Number J-25

Corner Designation : CORNER SECTION 12, 13, 7 & 18

Previous Renewals ORIGINAL SOURCE OF CORNER

UNDER GLO CONTRACT #81 BY D. THOMPSON DATED
JULY 8, 1859 SET POST

Accessories Found:

NONE


BASIS OF BEARINGS, NAD 83/91 OREGON STATE PLANE COORDINATES NORTH ZONE:

NORTHING: 762548.596
 EASTING: 8586100.921

- Condition Report Only
- Not Found
- Renewed
- Surveyed In
- Referenced

MONUMENT DETAIL

Found Set

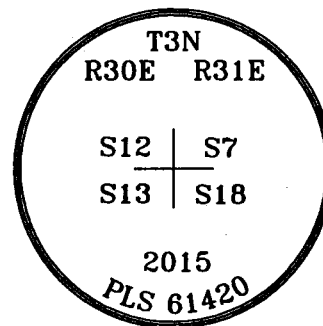

Monument & Accessories Set (Procedure and Description)

SET 2 1/2" BRASS CAP ON 1 1/2" PIPE AT GRADE, PLACED 4 LARGE ROCKS AROUND MONUMENT, SURVEY MARKER SIGN ON GREEN STEEL POST.

SET 5/8" REBAR & CAP PLS 61420 AT GRADE, N3°13'E 39.16', WITH BEARING OBJECT SIGN ON GREEN STEEL POST ON BERM.

SET 5/8" REBAR & CAP PLS 61420 AT GRADE, S88°49'E 46.20', IN REMNANTS OF WIRE FENCE ON BERM.

SET 5/8" REBAR & CAP PLS 61420 AT GRADE, S56°46'E 110.01', WITH BEARING OBJECT SIGN ON STEEL POST AT SW CORNER CONCRETE.

SET 5/8" REBAR & CAP PLS 61420 1' BELOW GRADE, N77°44'W 48.44'.

Sketch of Monument, Accessories and General Area

REGISTERED PROFESSIONAL LAND SURVEYOR

James King

OREGON
MAY 10, 2011
LANCE CLARK KING
61420

RENEWS: 6/30/2015

Agency:
CK3, LLC
945 W. ORCHARD
HERMISTON OREGON 97838
OFFICE: 541-567-2345
FAX: 541-567-2305
WEB: CK3LLC.NET
Field Book# 0-289

COUNTY SURVEYOR RECORDING INFO

Received *Day Robert*

Filed *6/12/2015*

Survey No. *15-050-C*

Drawing No. *C-853*

Index No. J-25