

OREGON CORNER RESTORATION FORM

SECTION 24 TOWNSHIP 4 NORTH RANGE 29 EAST P-25

COUNTY : UMATILLA DATE 8-98

CORNER DESIGNATION

E 1/4 Corner

CONDITION REPORT ONLY
 NOT FOUND
 RENEWED
 UNCOVERED
 SURVEYED IN
 REFERENCED

PREVIOUS RENEWALS / SURVEYS, ETC.


ORIGINALLY SURVEYED IN 1860 BY CABELL UNDER CONTRACT #95. HE SET A POST IN A MOUND OF EARTH AND A CHARRED STAKE.

MONUMENTS AND ACCESSORIES FOUND: CONDITION AND SOURCE

FOUND NOTHING

SKETCH

MONUMENT DETAIL

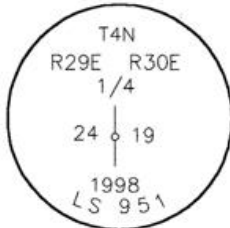

MONUMENT SET (PROCEDURES AND DESCRIPTION)

BY SINGLE PROPORTION, I SET A 1" X 30" IRON PIPE WITH A 2 3/8" BRASS CAP STAMPED AS ABOVE. 3" ABOVE THE SURFACE.

NEW ACCESSORIES FROM WHICH

AN ALUMINUM TAG #951 IN A POWER POLE LIES N 02°.47' E, 216.28 FEET.
AN ALUMINUM TAG #951 IN POWER POLE LIES S 03°.17'10" E, 131.08 FEET.
A 5/8" REBAR WITH PLASTIC CAP #951 LIES N 89°.57'40" E, 9.13 FEET.
A 5/8" REBAR WITH PLASTIC CAP #951 LIES S 03°.36'51" E, 213.23 FEET.

LOCATION AND COMMENTS

FROM THE INTERSECTION OF FEEDVILLE ROAD AND A LARGE POWER LINE, GO NORTH ALONG POWER LINE 0.5 MILES. CORNER LIES 9 FEET WEST OF FENCE.

COMPASS DEC.

SURVEYOR'S SEAL

FIRM/AGENCY
EDWARDS SURVEYING
P.O. BOX 763
HERMISTON, OREGON 97838
97838

PARTY CHIEF
D. EDWARDS

NOTES

WITNESS
RICK SMITH

RECEIVED BY

Umatilla County Surveyor

Date 10-98

Rec'd By KK

No. 98-213-C

REGISTERED
PROFESSIONAL
LAND SURVEYOR

G. Dennis Edwards

OREGON
JULY 16, 1971
G. DENNIS EDWARDS
951

RENEWS 12/31/99