

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established under GLO contract No.322, executed by George S. Pershin, dated July,1879. surveyor General field notes state:

Set a basalt stone 16x10x5 on N. E. face of spur for 1/4 sec. cor., from which:

- A Fir, 18" diam. bears, North 35° West, a dist. of 55 lks.
- A Fir, 13" diam. bears, South 6° West, a dist. of 27 lks.

Under contract No. 733, Charles L. and William C. Campbell, dated March, 1901, found original corner.

In Survey No. 93-64-C, Greg Flowers monuments the corner from original GLO evidence. Umatilla monumentation record states:

Found a basalt stone 15x9x5 with 1/4 clearly marked on it laying loosely on the N. E. face of a spur. A rotted stump bears South 6° West, 17.8ft., The tree that came from the stump we found 50' down the hill. It had evidence of scribing on it.

Set a 1 1/2"x30" iron pipe with a 2 1/2" brass cap, 14" in the ground with a mound of rocks to the top. Set the corner stone beside the monument as a witness. From which:

- An 18" Fir bears. North 77 1/2° East, a dist. of 165.60ft. marked T4NR37E S23 BT
- An 18" Fir bears South 67° East, a dist. of 81.4 ft. marked T4NR37E S26 BT
- A 17" Fir bears South 47 3/4° West, a dist. of 53.6 ft. marked T4NR37E S26 BT
- A 20" Fir bears North 4° West, a dist. of 68.2 ft. marked T4N R37E S23 BT
- A steel fence post with a Land Survey Monument sign attached bears North a dist. of 3 ft.

DESCRIPTION OF CORNER EVIDENCE FOUND:

I found a 1 1/2" galvanized iron pipe with a 2 1/2" brass cap, marked as shown below, 10" above ground, from which:

- A 22" Douglas Fir bears North 77°30' East, a dist. of 165.60 ft., alive and vigorous with partially healed blaze.
- A 28" Douglas Fir bears South 67° East, a dist. of 81.40 ft., alive and vigorous with scribe visible on partially healed blaze.

A 17" Douglas Fir stump bears South 47 3/4° West, a dist. of 53.60 ft., dead and down with scribes visible on partially healed blaze. Found down hill from stump 15 ft. up hill from found remains.

A 27" Douglas Fir bears North 4° West, a dist. of 70.80 ft., dead and standing with healed blaze. (Rec. 68.2 ft.)

A fence post with a sign approx. 5' North.

DESCRIPTION OF MONUMENT AND ACCESSORIES

I ESTABLISHED TO MONUMENT THE ORIGINAL

LOCATION OF THIS CORNER:

From 1 1/2" galvanized pipe,



NEW BEARING OBJECTS:

- A 31" Douglas Fir bears South 82° West, a dist. of 65.15 ft., marked 1/4 S 26 BT
- A 9" Douglas Fir bears North 26° West, a dist. of 50.90 ft., marked 1/4 S 23 BT

I hereby certify that the corner was perpetuated on October 27, 2021.

Witness: Kyle A. Tucker, Emmitt C. Ambert

T 4 N R 37 E R-19

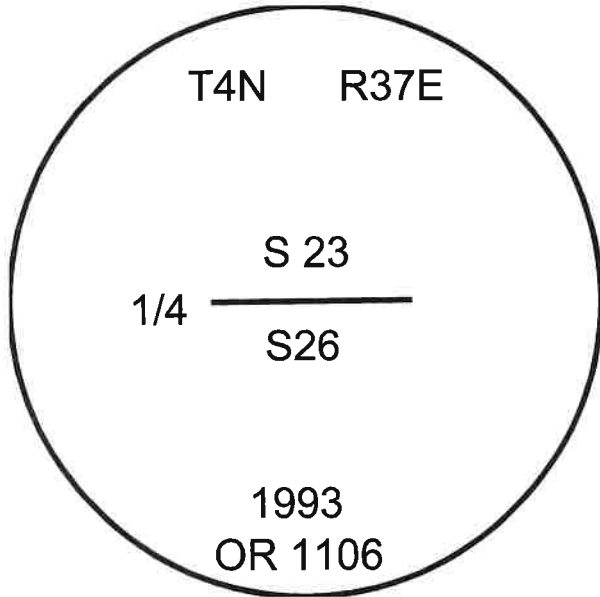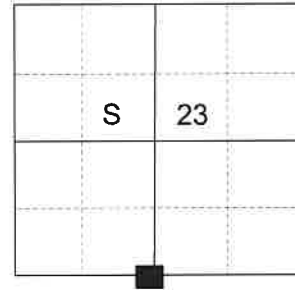

REGISTERED
PROFESSIONAL
LAND SURVEYOR



OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2023

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination. Distances are to a 60d spike driven into the right side of the root crown of the bearing trees. Bearings are to a brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.

21-124-B