


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1882 by George S. Pershin under General Land Office Contract No. 430. Surveyor General's records state:
Set pine post on East slope for cor. to Sec. 7, 18, 12 & 13.
A tamarack 12" dia. brs. N10°E 14 lks dist.
A fir 10" dia. brs. S57°E 54 lks. dist.
A pine 16" dia. brs. S25°W 50 lks dist.
A tamarack 18" dia. brs N51°W 25 lks dist.

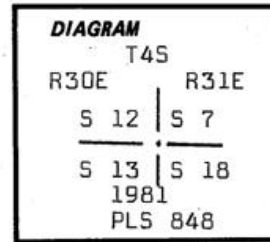

J-25

Description of corner evidence found:


After making a thorough search of the area, no evidence is found. No trees or remains of trees correspond to original notes. Corner is determined to be lost due to logging in the area; therefore, the position is determined by proportion.

Description of monument and accessories established to perpetuate the original location of this corner:

Set 3"x30" galv. iron pipe with 3" brass cap stamped as shown on the diagram, set 25 inches in the ground.
From which:
A fir 18 in. dia. bears N47°W, 13.7 ft. scribed T4S, R30E, S 12 BT.
A tamarack 6 in. dia. bears North, 6.8 ft. scribed X BT.
A fir 15 in. dia. bears S65°E. 28.2 ft. scribed T4S, R31E, S 18 BT.
A fir 8 in. dia. bears S27°W, 4.4 ft. scribed T4S, R30E, S 13 BT.
Set steel post with warning sign 4 ft. North from corner.
Nailed bearing tree signs and brass washers stamped PLS 848 to each tree.
Painted red band around each tree.

I hereby certify that the above corner monument was reestablished as herein described on 8/14/81.

Witnesses: _____
D. Mitchell Ferguson
Mike Woodward

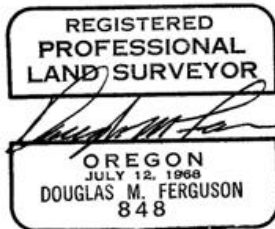

Office of Co. Surveyor _____ County of Umatilla _____
Oregon
State of _____ I hereby certify that the within instrument was filed in this office for record on the 7th day of January, 1982.
David Krumboltz by Betty Shatto
(COUNTY OFFICIAL) (DEPUTY)

82-01-c

T-2