

USDA-FOREST SERVICE

Index

File No. A-17

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

T 4S R. 31E

R.D. Ukiah

Tract or

Survey No. Sec 2

Cor.

No. NW Cor

Merid. Willamette

N.F. Umatilla

County Umatilla

State Oregon

CORNER DIAGRAM

S33

T3S R31E

S3 S2

T4S CC R31E



DESCRIBE CORNER MONUMENT FOUND

None.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

A 34" dia Ponderosa Pine bears S78°E 93.72 ft dist - (old BT, open healed blaze).

PHOTO IDENTIFICATION DATA

Photo No. _____

Filed At. _____

Object Ident. _____

Ident. By _____

Signature

PLANE COORDINATE POSITION DATA

State _____ Zone _____

X _____

Y _____

Estab. By _____

Agency

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Road #5420 to road #5412-100, then West on road #5412-100 approx. 2.1 miles to road fork to South through gate, then approx. 1,000 ft past gate road forks to South again for approx. 0.5 mile then turns West for approx. .25 mile to very faint road to Southwest near S 1/16 S33 & S34, then Southwest on faint road approx. 0.3 mile then South 400 ft to E-W fence then West over crest approx. 800 ft to corner by fence corner in timbered Southwest slope.

Signature

William R. Webb

Title

PLS 1106

Division

Headquarters

Date

October 21, 1982

7100-52-(3-68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Set 2 1/2" brass cap on 2 1/2" x 30" l. pipe 18" in ground with mound of stone.

Set steel fence post with 54-4 sign attached, West of corner. Corner located 13 1/2' North and 1 1/2' East of a fence corner. Cap marked:

S33
 T3S R31E
 S3 | S2
 T4S ~~CC~~R31E
 1982
 PLS 1106

ACCESSORIES: DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

A 12" dia Ponderosa Pine bears S54°W 29.7 ft dist marked: T4S R31E S3 BT.

A 12" dia Ponderosa Pine bears S51°E 29.2 ft dist marked: T4S R31E S2 BT.

Blaze faces and 6" bands around bearing trees are painted red. Tagged trees with 54-3 and 4 signs.

New BTs have a lower blaze, scribed BT, with a brass washer stamped PLS 1106 nailed flush.

Work Done By W.R. Wells Title Surveyor Date 10/21/82 State Registration No. PLS 1106
 or Agency

Certified Cor. Record Prepared? Yes No Filed At: Umatilla County Surveyor Office Date _____

REMARKS

Witnessed by: Leslie E. Wilson


Index
File No. A-17

CORNER RECORD (SEARCH)

Tract or
Survey No. 5-55 Cor.
No. A-17

T 4S R. 31E R.D. Ukiah County Umatilla
Merid. Willamette N.F. Umatilla State Oregon

CORNER DIAGRAM

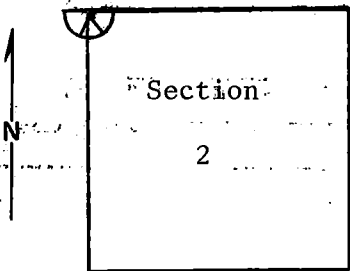

DESCRIBE CORNER MONUMENT FOUND

Material: Small rock mound only.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

48-inch p.pine tree in SE quadrant, with long and short blaze (closed).

Fence corner. (Fences run north and east.)
Rotten stump in SW quadrant is possible B.T.

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By. _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency

Signature B. Moore Title Engineering Technician Division _____ Headquarters S. O. Date November 1974 7100-52
REV. 65 5

CORNER RECORD (PERPETUATION)

MONUMENT : DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

9

ACCESSORIES : DESCRIBE NEW BT's WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

10

Work Done By _____ Title _____ Date _____ State Registration No. or Agency _____

Certified Cor. Record Prepared ? Yes No Filed At: _____ Date _____

11

REMARKS

12

Index File No. T. R. M. Tract or Surv. No. Cor. _____

13