


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established in 1881 by George S. Pershin as follows:

At 80.00 chains north of section corner  $\frac{21}{28} \mid \frac{22}{27}$ , set a basalt stone 16"x12"x8", 11" in ground marked with 3 notches on South and 3 notches on East edges, from which:

- A Tamarack, 8" dia. brs. N28°E, 43 lks (28.4 ft.) marked T4S, R33E, S15, BT.
- A Tamarack, 10" dia. brs. S38°E, 113 lks (74.6 ft.) marked T4S, R33E, S22, BT.
- A Tamarack, 10" dia. brs. S53°W, 73 lks (48.2 ft.) marked T4S, R33E, S21, BT.
- A Pine, 6" dia. brs. N43°W, 23 lks (15.2 ft.) marked T4S, R33E, S16, BT.

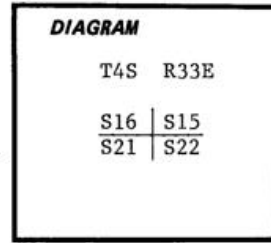

N-13

Description of corner evidence found:

From the corner position, which is in Road No. 54, I find the following original corner evidence:

A decayed tamarack log lying on the ground with an axe face and fragmentary scribing. Root hole where this tree stood bears S53°W, 48.2 ft.

A root hole, with a badly decayed tamarack log lying alongside, bears S38°E, 74.6 feet. No scribes or marks remain. Location of the original NE & NW bearing trees falls in the roadway.

I also find the following evidence of perpetuation efforts, not of record: A location tag, on a lodgepole pine, is marked "W29' to COR, '63 T. Holden". This tag bears S83°E, 30.6 ft. from corner. A location tag on the ground on edge of root hole of SW BT is dated 1944.


Description of monument and accessories established to perpetuate the original location of this corner:

At the corner point, as determined from the original evidence, I set a ½"x24" iron rod. The top of the rod is 6" below the road surface. From which bears:

- A 2½"x30" galvanized iron pipe with a 3" brass cap attached. The iron pipe is set 26" into the ground. The brass cap is marked: W.C.
- This witness corner bears East, 40.0 ft. from the section corner. T4S R33E
- A 15" larch bears S89° 30'E, 45.5 ft. scribed "T4S, R33E, S22, BT" on double blazes. S16 S15
- A 13" Douglas-fir bears S71°W, 49.3 ft. scribed "T4S, R33E, S21, BT" on double blazes. S21 S22
- A 12" Douglas-fir bears N62°W, 41.6 ft. scribed "T4S, R33E, S16, BT" on double blazes. PLS 1636
- A 23" ponderosa pine bears N32°E, 126.5 ft. scribed "T4S, R33E, S15, BT" on double blazes. De: 20° East. 1981

54-3 and 54-4 signs were placed on all four new bearing trees.

I hereby certify the above corner location was perpetuated as hereon described on October 28, 1981. Witness: John T. Hall.

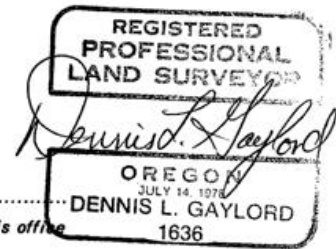

Office of County Surveyor ..... County of Umatilla  
 State of Oregon ..... I hereby certify that the within instrument was filed in this office  
 for record on the 27 day of December ..... 1981  
Dennis L. Gaylord ..... by Betty Smith  
 (COUNTY OFFICIAL) (DEPUTY)

RECEIVED BY  
 Umatilla County Surveyor  
 Date 12-81  
 rec'd by BLS  
 No. S-137-C