


History of original corner establishment:

The corner was originally established by George S. Pershin under Contract No. 390 dated May 12, 1881. The original notes state that a 5" square wood post was set in a mound of stones for corner. No bearing trees were available.

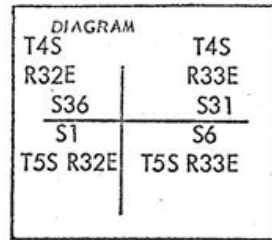

No record of subsequent remonumentation found in County Records .  
Description of corner evidence found:

None. Corner was re-established by double proportion measure.

Description of monument and accessories established to perpetuate the original location of this corner

At the corner position a 2 inch by 30 inch iron pipe, with brass cap marked as shown, was set 10 inches in the ground and surrounded with a mound of stones. Set steel fence post north and east of corner and attached 54-2 to both posts & 54-4 to one post. No BT's available. Set 4 reference monuments. Reference monuments are 2"x30" galvanized iron pipes with brass caps set 10" in ground with a mound of stones around them. Set fence post and attached sign 54-4 near each reference monument.

From the corner:


- 1) A.R.M. bears N77° W 29.89 ft marked: ① T4S R32E
- 2) A.R.M. bears N17½° E 21.81 ft. marked: ② T4S R33E
- 3) A.R.M. bears S39° E 14.94 ft. marked: ③ T5S R33E
- 4) A.R.M. bears S64° W 35.59 ft. marked: ④ T5S R32E

Used steel tape and magnetic compass with 19½° east declination. Measured to center of R.M.'s  
See map of survey

This corner set July 26, 1979

Witnesses: Greg Flowers, L.S.I.T.  
Brent Reynolds

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR  
*William R. Wells*  
OREGON  
JULY 22, 1977  
WILLIAM R. WELLS  
1106

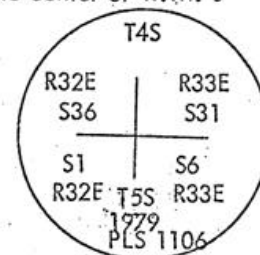

Office of \_\_\_\_\_ County Surveyor \_\_\_\_\_ County of Umatilla  
State of Oregon, I hereby certify that the within instrument was filed in this office  
for record on the \_\_\_\_\_ day of \_\_\_\_\_  
\_\_\_\_\_ by \_\_\_\_\_  
(COUNTY OFFICIAL) (DEPUTY)

Q-1134-B