

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

R-05
200300
T. 5 S., R. 33 E.
Corner of sections 19, 20, 29 & 30


History of original corner establishment:

1882, George S. Pershin, U.S. Deputy Surveyor, while subdividing the township under G.L.O. Contract No. 430 established the corner as follows:

Set a basalt Stone 18 X 8 X 6 in. 12 ins in ground on level for cor. to sec. 19, 20, 29, and 30 marked with 2 notches on S and 5 notches on E edges

A Pine 28 in dia. brs. N. 69° E. 239 lks dist marked T5S.R.33E.S.20B.T.

A Pine 16 ins. dia. brs. S. 64° E. 279 lks dist marked T5S.R.33E.S29.B.T.
No other trees near raised a mound of stone along side

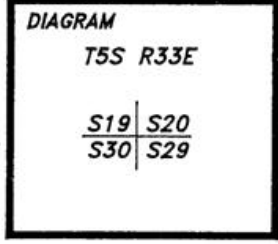

1977, Craig L. Wanless, BLM Cadastral Surveyor, Found

The cor. of secs. 19, 20, 29, and 30, monumented with the original basalt stone, 18 X 8 X 6 ins., loosely set 1 in. in the ground, with 5 notches on E. and 2 notches on S. edges, from which the remains of the original bearing trees:

A root hole, bears N. 69° E., 239 lks. dist., with a down and decayed pine alongside, size indeterminate, no marks visible.

A pine, 38 ins. diam., bears S. 64° E., 279 lks. dist., with fragmentary scribe marks visible on open blaze.

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground with brass cap, from which a new bearing tree

A lodgepole pipe, 18 ins. diam., bears N. 59 1/2° E., 308 lks. dist., mkd. T5S R33E S20 BT. No other suitable trees available within limits.

Deposit corner stone and set a 5 ft. steel fence post alongside iron post.

Corner is located 3 lks. east of wire fence, extending N. and S.

1984, David H. Krumbein, LS 933, (CS# 84-158-R) Found a BLM Brass cap:

A 12" Ponderosa Pine bears N 59° E, 262 feet scribed T 5 S R 33 E S 20 BT

A 40" Ponderosa Pine bears S 64° E, 279 links with fragmentary scribing visible

Set a 5/8" X 30" iron rebar with an aluminum cap stamped PLS 933 N 45° W, 20.00 feet.

Set a 5/8" X 30" iron rebar with aluminum cap stamped PLS 933 S 45° W, 20.00 feet.

Description of corner evidence found:

Found a 2 1/2" diameter iron pipe, with 3 1/4" diameter brass cap, projecting 9" out of the ground, 0.6 feet East of a North-South fenceline, marked as shown, from which:

22" Ponderosa Pine bears N 56° E, 262.3 feet, with healed blaze.

43" Ponderosa Pine bears S 65 1/2° E, 184.1 feet, with healed blaze previously chopped open.



Description of monument and accessories established to perpetuate the original location of this corner:

New References:

7" Ponderosa Pine bears S 52° E, 186.6 feet, scribed "T5S R33E S29" "BT".
RM, 5/8" diameter by 24" long rebar with 1 1/4" diameter red plastic cap stamped "UMATILLA N.F.", set 16" in the ground, bears N 0°23' W, 61.81 feet.

The new bearing tree is double blazed and has a 3/4" diameter brass washer stamped "RLS 2308" nailed to the lower blaze by the "BT" scribing.

DATUM: NAD83(1991) Oregon High Accuracy Reference Network

STATE PLANE COORDINATES: Oregon North Zone in International Feet

| | | | | |
|--------|--------------------|---------------------|-------------|--------------|
| No. | Latitude | Longitude | Northing(Y) | Easting(X) |
| 200300 | 45°06'46.04905" N. | 118°45'28.54835" W. | 532063.417' | 8651777.995' |

REGISTERED
PROFESSIONAL
LAND SURVEYOR

David A. Schlaich

OREGON
JULY 16, 1987
DAVID A. SCHLAICH
2308

RENEWAL DATE: 06/30/2004

Work Performed By: David A. Schlaich (RLS 2308)

Equipment: Topcon GPT-6005C Total Station

Magnetic Declination: 19 1/2° East

Date: October 1, 2002

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 20.....

..... by.....
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

SEE MAP OF SURVEY NO. 03-019-B