

OREGON CORNER RESTORATION FORM

Section 30 Township 6N Range 34E
 County Umatilla Date: December 11, 2002

Corner Designation: 6N34T1

Quarter corner common to section 25, T6N, R33E and section 30, T6N, R34E, W.M., Umatilla County, Oregon.

State Plane Coordinates, Oregon North, 83(1991)
 N = 844552.11 E = 8679747.38



Condition Report Only
 Not found
 Remonumented
 Unrecorded
 Surveyed in
 Referenced out

Previous Renewals / Surveys, etc.

Corner originally set by Deputy Surveyors Odell & Lewis under contract No. 110 dated February 7th, 1865. Their record reads: Set 1/4 sec. post cor. Drove charred stake, dug pits & raised mound as per instructions. Willard Bradley, in survey Q-813-A dated March, 1914, calls for "1/4 cor. old stake" and set a stone. He also graphically shows the "gully" the corner is in. Aubrey Perry, in the survey found in Book 2, Page 306 of the record of private surveys dated April 7-8, 1919 states "dug up granite rock marked 1/4 buried 6" in ground in drive way to field w. of ravine."

Monument and Accessories found: (condition and source)

A decayed, charred stake approximately 2" diameter in the middle of the old field access road under the existing fence. A burnt off gate post still attached to the fence was lying in the grass on the east side of the road. This position is in the correct "gully" as per Bradley's survey.

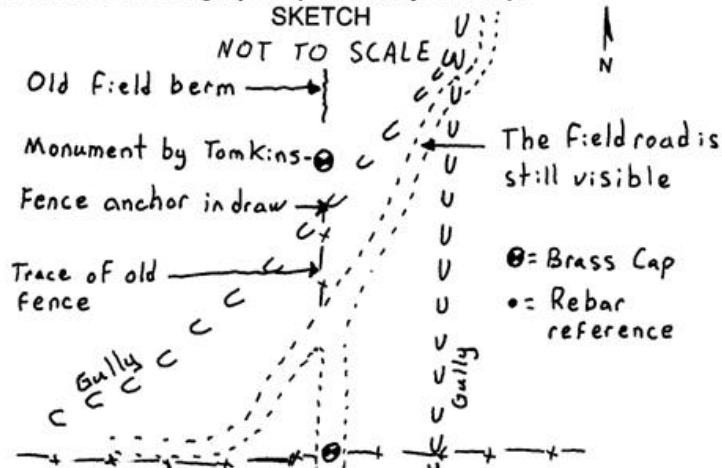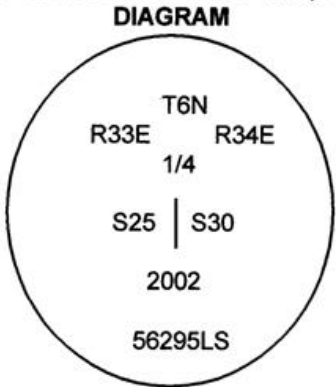

MONUMENT (S) AND ACCESSORIES SET (Procedures and Description)

I set a 2 1/4" brass cap stamped as shown in the daigram above on a 1 1/2" x 30" galvanized iron pipe, 30" in the ground at the position of the charred stake.

For references, I set four 5/8" by 24", green coated, iron rebars with 1 1/8" orange plastic caps stamped WTS and 56295LS as described below:

- an iron rebar bears N89°53'14"E, 22.37 feet, under the existing fence;
- an iron rebar bears S87°44'58"W, 23.73 feet, under the existing fence;
- an iron rebar bears N4°11'06"W, 42.31 feet, 18" beneath the surface;
- an iron rebar bears N4°15'56"W, 74.55 feet, 18" beneath the surface;

The monument and references were tied using a LIECA system 300 RTK GPS.

Location and comments
 Monument and location witnessed by David L. Haddock, PLS 852.
 RECEIVED BY:
Umatilla County Surveyor
 Date: 2-03
 Rec'd By: KK
 No. 03-21-BC

Compass Declination
 Firm / Agency
 Witness Tree Surveying
 Address
 P.O. Box G
 Pilot Rock, Or. 97868
 Party Chief
 Stephen K, Haddock

Surveyors Seal

