

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla. DATE: 04/04/08

CORNER DESIGNATION: N-13, The Southeast Corner of Section 16, Township 6 North, Range 36 East, W.M..

PREVIOUS RENEWALS/SURVEYS ETC.: Corner originally established by Odell & Lewis under GLO Contract No. 110, dated February 7, 1865. Notes state: Set post corner for secs 15, 16, 21 & 22. Drove charred stake, dug pits and raised mound as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL:

T6N R36E
S16 | S15
S21 | S22
2008
PLS 1106

MONUMENT SET: Held the intersection of old field berm and fence remains extending East-West with a dim field line extending North as the best remaining evidence of the original corner location. At the reestablished corner point, set a 2 3/8" brass cap 1 1/4" x 30" galvanized iron pipe with cap flush with ground, marked as shown in "Monument Marking Detail".

New accessories:

A brass washer stamped "PLS 1106, 1 foot above ground line in a power pole, bears North 32° East, 5.3 feet. Attached bearing object sign and witness sign to the power pole.

A purple deep-1 magnet bears South 44° East, 24.6 feet.

A blue deep-1 magnet bears South 52 1/2° West, 25.2 feet.

An orange deep-1 magnet bears North 36° West, 35.9 feet.

Deep 1 magnets are buried 20" below ground level with bearing object signs.

LOCATION AND COMMENTS: Corner fall in East-West field berm with dim field line going North about 0.7 feet West of a 4 inch well casing. A power pole line parallels the East-West field berm approximately 5 feet North of it. Old buried fence wire, East and West, was found 18" below ground was found while digging the monument hole.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:

N = 854833.46

E = 8758871.36

FIRM: Wells Surveying

P.O. Box 1696


Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Surveyor's Seal

Witnesses: Jason Wells, LSIT

\6N36N13

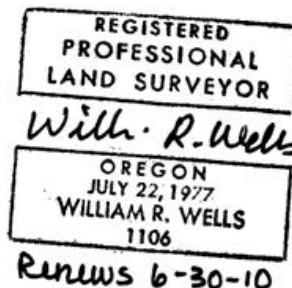

09-10-c