

OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 6/30/2014

CORNER DESIGNATION:

Z-11, Quarter corner common to Section 33 Township 6 North, Range 37 East and Section 4, Township 5 North, Range 37E, W.M.

PREVIOUS RENEWALS/SURVEYS ETC:

Originally surveyed by William H. Odell and William S. Lewis, Deputy Surveyors, Contract No. 110, dated February 7, 1865. Their notes state "Set quarter section post on side hill facing the South, made corner of basalt stone 14x12x4."

MOUNUMENT AND ACCESSORIES FOUND:

No evidence found.

MOUNUMENT MARKING DETAIL:

 T6N
¼ $\frac{S33}{S4}$ R37E
 2014 T5N
 LS 02820

MOUNUMENT AND ACCESSORIES SET:

At the surveyed position, set a 1½" x 30" galvanized iron pipe with a 2½" brass cap stamped as the quarter corner common to Section 34 Township 6 North, Range 37 East and Section 3, Township 5 North, Range 37E, in a 2.00 foot hole in bedrock. The monument is +/- .80 feet above ground from which:

- Set a 5/8" iron rebar with yellow plastic cap marked "TLS-HDJ" bears N32°W, 30.60 feet.
- Set a 5/8" iron rebar with yellow plastic cap marked "TLS-HDJ" bears N52°E, 25.20 feet.
- Set a 5/8" iron rebar with yellow plastic cap marked "TLS-HDJ" bears S35°E, 33.80 feet.
- Set a 5/8" iron rebar with yellow plastic cap marked "TLS-HDJ" bears S79°W, 30.60 feet.

LOCATION AND COMMENTS:

Monument is on a south facing slope. Bearings taken with Silva hand compass and distances measured with a steel tape.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet:


N = 840340.02
E = 8788329.68

COMPASS DECLINATION: 15° East

SURVEYORS' SEAL:

FIRM: HDJ Design Group
5 N. Colville, Suite 200
Walla Walla WA 99362

WITNESSES: Justin M Koberle
Felipe G. Hernandez

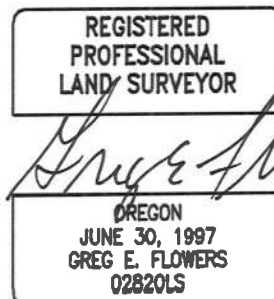

RENEWS 12/31/15

06/29/2015