

Index
File No. E-09

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or Survey No. _____ Cor. No. _____

T 6S R. 35E

R.D. La Grande County Union & UMATILLA

Merid. Willamette

N.F. Willowa-Whitman State Oregon

CORNER DIAGRAM



5	4
8	9

DESCRIBE CORNER MONUMENT FOUND

NONE

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

24" TAMARACK N 58° E 20⁴⁶ Feet Partly Healed Blaze, unreadable
S 15° W 10 Ft. Stump Hole and Rotted remains
Showing Chop MARKS and Blaze but Scribing Faint.

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____

Signature

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____

Agency

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

50 feet North of Creek
Road 5160 to Road 5160-155 to End of Road
Then 500 Feet ~~W~~ NE Along Creek

Signature D. Scott

Title LS 1844

Division _____

Headquarters _____

Date 9/19/84

FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Set 2 1/2" Alum CAP on 2 3/8" X 30" Alum Pipe
 Rising 11" Above Ground
 Set steel Fnc Post 3° North

T65 R35E
 55 54
 58 59
 PLS 1844
 1984

ACCESSORIES: DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

8" Fir N 31° W, 10⁸ FT, MARKED T65 R35E S 5 BT
 10" Fir S 7 1/2° W, 8⁶ FT, MARKED T65 R35E S 8 BT
 6" Fir S 55° E, 24¹ FT, MARKED T65 R35E S 9 BT
 Painted 6" Red Bands around Trees and Attached Signs 54-3 and 54-4

Work Done By D. Scott Title Surveyor Date 9/19/84 State Registration No. LS 1844
 or Agency

Certified Cor. Record Prepared? Yes No Filed At: Union Co. Surveyor's Office Date

REMARKS Umatilla Co Surveyor's Office

Index File No. T. 6S R. 35E M. Will Tract or Surv. No. Cor.

E-09

Index
File No. E-9

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or Survey No. _____
Cor. No. 5/4
8/9


T 69g R. 35E.

R.D. LA GRANDE County UNION

Merid. WILL.

N.F. w-w State ORE.

CORNER DIAGRAM

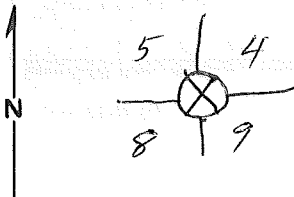

DESCRIBE CORNER MONUMENT FOUND

None

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

Sec. 4 24" W.L. live in good condition with scribes visible. all other trees have rotted away. Some remains are present

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Painted BT + put up signs,

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency

Signature

D. Dahlstrom

Title

CET

Division

La Grande

Headquarters

Date

6-1-84

FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT : DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

9

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

10

Work Done By _____ Title _____ Date _____ State Registration No. or Agency _____

Certified Cor. Record Prepared ? Yes No Filed At: _____ Date _____

11

REMARKS

12

Index File No. T. R. M. Tract or Surv. No. Cor.

13