


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner was originally established by David Krumbein in Umatilla County Survey J-77-B. Survey record states:


Set Br. Cap

T 1 S R 35 E H-13

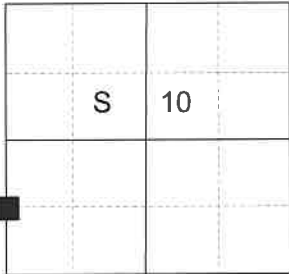

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 2 1/2" galvanized pipe with 2 1/2" brass cap marked as shown, 12" above ground in fence corner to Southeast, Northerly, and Westerly bearing fence lines on North side of cattle guard. Found monument bears North 36°58'28" West, a distance of 17.11 feet, from true corner position.

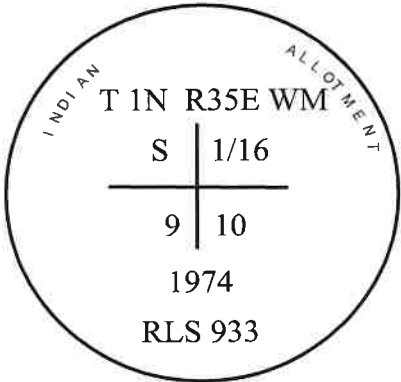

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey I set a 2 1/2" x 30" aluminum pipe, 30" in the ground and flush with the gravel road surface in a 2 ft. diam. collar of stone, with 3" aluminum cap marked as shown below, from which:


NEW BEARING OBJECTS:

A 9" Lodgepole Pine bears North 79° East, a dist. of 16.10 feet, marked S 1/16 S10 BT.
A 9" Lodgepole Pine bears North 28° West, a dist. of 35.05 feet, marked S 1/16 S9 BT.

Set steel fence post approx. 1 ft. South

I hereby certify that the corner was monumented November 4, 2025

Witness: Kyle Tucker, Nick Peckham

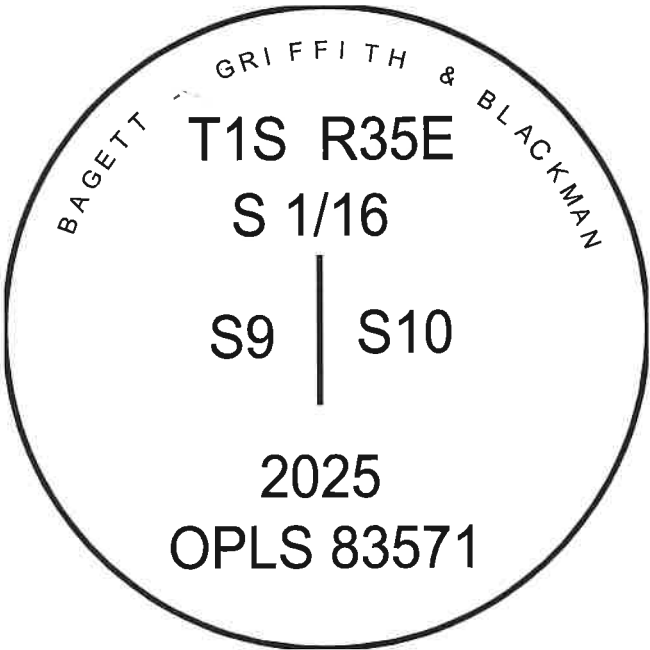

Renewal Date: June 30, 2027

I use a tape and compass in the establishment of the new bearing trees. Bearings are measured from the center of the aluminum cap to a brass washer marked "OPLS 83571" tacked to the BT blaze using 14° East for declination. Distances are measured to from the center of the brass cap to a 60D spike in the center right base of the tree.